



A Leading Provider of Microcontrollers & Analog Semiconductors

Date: 07 Jun 2011

Product Category: 16-bit Microcontrollers and Digital Signal Controllers; 8-bit Microcontrollers

Device Family:  

Notification subject: ERRATA - dsPIC30F6011A/6012A/6013A/6014A Family Silicon Errata and Data Sheet Clarificati Errata Document Revision

Notification text: SYST-07CTWI987

Microchip has released a new DeviceDoc for the dsPIC30F6011A/6012A/6013A/6014A Family Silicon Errata and Data Sheet Clarificati of devices. If you are using one of these devices please read the document located at [dsPIC30F6011A/6012A/6013A/6014A Family Silicon Errata and Data Sheet Clarificati](#).

Notification Status: Final

Description of Change: Removed previous data sheet clarification 1 and added new data sheet clarification 1 (DC Characteristics: Operating MIPS vs. Voltage), 2 (DC Characteristics: Operating Current (I_{dd})), and 3 (DC Characteristics: Operating Current (Idle)).

Pre Change: N/A

Post Change: N/A

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 07 Jun 2011

NOTE: Please be advised that this is a change to the document only the product has not been changed.

Markings to Distinguish Revised from Unrevised Devices: N/A

Attachment(s): [dsPIC30F6011A/6012A/6013A/6014A Family Silicon Errata and Data Sheet Clarificati](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to change your product/process change notification (PCN) profile please log on to our website at <http://www.microchip.com/PCN> sign into myMICROCHIP to open the myMICROCHIP home page, then select a profile option from the left navigation bar.

To opt out of future offer or information emails (other than product change notification emails), click here to go to [microchipDIRECT](#) and login, then click on the "My account" link, click on "Update profile" and un-check the box that states "Future offers or information about Microchip's products or services."

Product Change Notification - SYST-07CTWI987

dsPIC30F6011A/6012A/6013A/6014A Family Silicon Errata and Data Sheet Clarification

The dsPIC30F6011A/6012A/6013A/6014A family devices that you have received conform functionally to the current Device Data Sheet (DS70143E), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the dsPIC30F6011A/6012A/6013A/6014A silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**B1**).

Data Sheet clarifications and corrections start on [page 13](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 3 or PICKit™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 3 programmer/debugger or PICKit 3.
2. From the main menu in MPLAB IDE, select *Configure>Select Device*, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (*Debugger>Select Tool*).
4. Perform a "Connect" operation to the device (*Debugger>Connect*). Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various dsPIC30F6011A/6012A/6013A/6014A silicon revisions are shown in [Table 1](#).

TABLE 1: SILICON DEVREV VALUES

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾		
		A2	B0	B1
dsPIC30F6011A	0x02C0	0x1002	0x1040	0x1041
dsPIC30F6012A	0x02C2			
dsPIC30F6013A	0x02C1			
dsPIC30F6014A	0x02C3			

- Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.
- 2:** Refer to the "dsPIC30F Flash Programming Specification" (DS70102) for detailed information on Device and Revision IDs for your specific device.

dsPIC30F6011A/6012A/6013A/6014A

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾		
				A2	B0	B1
CPU	DAW.b Instruction	1.	The Decimal Adjust instruction, DAW.b, may improperly clear the Carry bit, C (SR<0>).	X	X	X
Output Compare	PWM Mode	2.	Output compare will produce a glitch when loading 0% duty cycle in PWM mode. It will also miss the next compare after the glitch.	X	X	X
Sleep Mode	—	3.	Execution of the Sleep instruction (PWRSAV #0) may cause incorrect program operation after the device wakes up from Sleep. The current consumption during Sleep may also increase beyond the specifications listed in the device data sheet.	X	X	
I ² C™	Slave Mode	4.	The I ² C module loses incoming data bytes when operating as an I ² C slave.	X	X	X
I/O	Port Pin Multiplexed with IC1	5.	The Port I/O pin multiplexed with the Input Capture 1 (IC1) function cannot be used as a digital input pin when the UART auto-baud feature is enabled.	X	X	X
I ² C	10-bit Addressing	6.	When the I ² C module is configured for 10-bit addressing using the same address bits (A10 and A9) as other I ² C devices, the A10 and A9 bits may not work as expected.	X	X	X
Timer	Sleep Mode	7.	Clock switching prevents the device from waking up from Sleep.	X	X	X
PLL	Lock Status bit	8.	The PLL LOCK Status bit (OSCCON<5>) can occasionally get cleared and generate an oscillator failure trap even when the PLL is still locked and functioning correctly.	X	X	X
PSV Operations	—	9.	An address error trap occurs in certain addressing modes when accessing the first four bytes of any PSV page.	X	X	X
I ² C	10-bit Addressing	10.	The 10-bit slave does not set the RBF flag or load the I2CxRCV register, on address match if the Least Significant bits (LSBs) of the address are the same as the 7-bit reserved addresses.	X	X	X
I ² C	10-bit Addressing	11.	When the I ² C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02.	X	X	X
I ² C	Bus Collision	12.	When the I ² C module is enabled, the dsPIC® DSC device generates a glitch on the SDA and SCL pins, causing a false communication start in a single-master configuration or a bus collision in a multi-master configuration.	X	X	X
CAN	RX Filters 3, 4 and 5	13.	CAN Receive filters 3, 4 and 5 may not work for a given combination of instruction cycle speed and CAN bit time quanta.	X	X	X
CPU	MAC Class Instructions with ±4 Address Modifications	14.	Sequential MAC instructions, which prefetch data from Y data space using ±4 address modification will cause an address error trap.	X		
CPU	DISI Instruction	15.	The DISI instruction will not disable interrupts if a DISI instruction is executed in the same instruction cycle that the DISI counter decrements to zero.	X		
Output Compare	—	16.	The Output Compare module will produce a glitch on the output when an I/O pin is initially set high and the module is configured to drive the pin low at a specified time.	X		
OSC2 Pin	RC15 as Digital I/O	17.	For this revision of silicon, pin OSC2/RC15 is operational for digital I/O and CLKOUT only in specific oscillator modes.	X		

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

dsPIC30F6011A/6012A/6013A/6014A

TABLE 2: SILICON ISSUE SUMMARY (CONTINUED)

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾		
				A2	B0	B1
LP Oscillator	—	18.	For this revision of silicon, the LP Oscillator is not operational.	X		
ADC	Sleep Mode	19.	ADC event triggers from the INT0 pin will not wake-up the device from Sleep mode if the SMPI bits are non-zero.	X		
PLL	4x and 8x Modes	20.	If 4x or 8x PLL mode is used, the input frequency range is 5 MHz-10 MHz instead of 4 MHz-10 MHz.	X		
ADC	Current Consumption in Sleep Mode	21.	If the ADC module is in an enabled state when the device enters Sleep Mode, the power-down current (IPD) of the device may exceed the device data sheet specifications.	X	X	X

Note 1: Only those issues indicated in the last column apply to the current silicon revision.

dsPIC30F6011A/6012A/6013A/6014A

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**B1**).

1. Module: CPU

The Decimal Adjust instruction, `DAW.b`, may improperly clear the Carry bit, `C` (`SR<0>`), when executed.

Work around

Check the state of the Carry bit prior to executing the `DAW.b` instruction. If the Carry bit is set, set the Carry bit again after executing the `DAW.b` instruction. [Example 1](#) shows how the application should process the Carry bit during a BCD addition operation.

EXAMPLE 1: CHECK CARRY BIT BEFORE `DAW.b`

```
.include "p30fxxxx.inc"
.....
mov.b #0x80, w0 ;First BCD number
mov.b #0x80, w1 ;Second BCD number
add.b w0, w1, w2 ;Perform addition
bra NC, L0 ;If C set go to L0
daw.b w2 ;If not,do DAW and
bset.b SR, #C ;set the carry bit
bra L1 ;and exit
L0:daw.b w2
L1: .....
```

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

2. Module: Output Compare

If the desired duty cycle is '0' (`OCxRS = 0`), the module will generate a high level glitch of 1 `Tcy`. Additionally, on the next cycle after the glitch, the OC pin does not go high, or, in other words, it misses the next compare for any value written on `OCxRS`.

Work around

There are two possible solutions to this problem:

1. Load a value greater than '0' to the `OCxRS` register when operating in PWM mode. In this case, no 0% duty cycle is achievable.
2. If the application requires 0% duty cycles, the Output Compare module can be disabled for 0% duty cycles, and re-enabled for non-zero percent duty cycles.

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

dsPIC30F6011A/6012A/6013A/6014A

3. Module: Sleep Mode

Execution of the Sleep instruction (PWRSAV #0) may cause incorrect program operation after the device wakes up from Sleep. The current consumption during Sleep may also increase beyond the specifications listed in the device data sheet.

Work arounds

To avoid this issue, implement any of the following three work arounds, depending on the application requirements.

Work around 1:

Ensure that the PWRSAV #0 instruction is located at the end of the last row of program Flash memory available on the target device and fill the remainder of the row with NOP instructions.

This can be accomplished by replacing all occurrences of the PWRSAV #0 instruction with a function call to a suitably aligned subroutine. The address() attribute provided by the MPLAB ASM30 assembler can be utilized to correctly align the instructions in the subroutine. For an application written in C, the function call would be GotoSleep(), while for an assembly language application, the function call would be CALL _GotoSleep.

The Address Error Trap Service Routine (TSR) software can then replace the invalid return address saved on the stack with the address of the instruction immediately following the _GotoSleep or GotoSleep() function call. This ensures that the device continues executing the correct code sequence after waking up from Sleep mode.

[Example 2](#) demonstrates the work around described above.

EXAMPLE 2:

```
-----  
;-----  
.global __reset  
.global __main  
.global _GotoSleep  
.global __AddressError  
.global __INT1Interrupt  
;-----  
; .section *, code  
__main:  
  BSET   INTCON2, #INT1EP   ; Set up INT pins to detect falling edge  
  BCLR   IFS1, #INT1IF     ; Clear interrupt pin interrupt flag bits  
  BSET   IEC1, #INT1IE     ; Enable ISR processing for INT pins  
  CALL   _GotoSleep        ; Call function to enter SLEEP mode  
__continue:  
  BRA   __continue  
;-----  
; Address Error Trap  
__AddressError:  
  BCLR   INTCON1, #ADDRERR  
  ; Set program memory return address to __continue  
  POP.D  W0  
  MOV.B  #tblpage (__continue), W1  
  MOV    #tbloffset (__continue), W0  
  PUSH.D W0  
  RETFIE  
;-----  
__INT1Interrupt:  
  BCLR   IFS1, #INT1IF     ; Ensure flag is reset  
  RETFIE                    ; Return from Interrupt Service Routine  
;-----  
; .section *, code, address (0x1FC0)  
__GotoSleep:  
; fill remainder of the last row with NOP instructions  
  .rept 31  
    NOP  
  .endr  
; Place SLEEP instruction in the last word of program memory  
  PWRSAV #0
```

dsPIC30F6011A/6012A/6013A/6014A

Work around 2:

Instead of executing a `PWRSV #0` instruction to put the device into Sleep mode, perform a clock switch to the 512 kHz Low-Power RC (LPRC) Oscillator with a 64:1 postscaler mode. This enables the device to operate at 0.002 MIPS, thereby significantly reducing the current consumption of the device. Similarly, instead of using an interrupt to wake-up the device from Sleep mode, perform another clock switch back to the original oscillator source to resume normal operation. Depending on the device, refer to **Section 7. "Oscillator"** (DS70054) or **Section 29. "Oscillator"** (DS70268) in the "*dsPIC30F Family Reference Manual*" (DS70046) for more details on performing a clock switch operation.

Note: The above work around is recommended for users for whom application hardware changes are not possible.

Work around 3:

Instead of executing a `PWRSV #0` instruction to put the device into Sleep mode, perform a clock switch to the 32 kHz Low-Power (LP) Oscillator with a 64:1 postscaler mode. This enables the device to operate at 0.000125 MIPS, thereby significantly reducing the current consumption of the device. Similarly, instead of using an interrupt to wake-up the device from Sleep mode, perform another clock switch back to the original oscillator source to resume normal operation. Depending on the device, refer to **Section 7. "Oscillator"** (DS70054) or **Section 29. "Oscillator"** (DS70268) in the "*dsPIC30F Family Reference Manual*" (DS70046) for more details on performing a clock switch operation.

Note: The above work around is recommended for users for whom application hardware changes are possible, and also for users whose application hardware already includes a 32 kHz LP Oscillator crystal.

Affected Silicon Revisions

A2	B0	B1					
X	X						

dsPIC30F6011A/6012A/6013A/6014A

4. Module: I²C

When the I²C module is configured as a slave, either in single-master or multi-master mode, the I²C receiver buffer is filled whether a valid slave address is detected or not. Therefore, an I²C receiver overflow condition occurs and this condition is indicated by the I2COV flag in the I2CSTAT register.

This overflow condition inhibits the ability to set the I²C receive interrupt flag (SI2CF) when the last valid data byte is received. Therefore, the I²C slave Interrupt Service Routine (ISR) is not called and the I²C receiver buffer is not read prior receiving the next data byte.

Work arounds

To avoid this issue, either of the following two work arounds can be implemented, depending on the application requirements.

Work around 1:

For applications in which the I²C receiver interrupt is not required, the following procedure can be used to receive valid data bytes:

1. Wait until the RBF flag is set.
2. Poll the I²C receiver interrupt SI2CIF flag.
3. If SI2CF is not set in the corresponding Interrupt Flag Status (IFSx) register, a valid address or data byte has not been received for the current slave. Execute a dummy read of the I²C receiver buffer, I2CRCV; this will clear the RBF flag. Go back to step 1 until SI2CF is set and then continue to Step 4.
4. If the SI2CF is set in the corresponding Interrupt Flag Status (IFSx) register, valid data has been received. Check the D_A flag to verify that an address or a data byte has been received.
5. Read the I2CRCV buffer to recover valid data bytes. This will also clear the RBF flag.
6. Clear the I²C receiver interrupt flag SI2CF.
7. Go back to step 1 to continue receiving incoming data bytes.

Work around 2:

Use this work around for applications in which the I²C receiver interrupt is required. Assuming that the RBF and the I2COV flags in the I2CSTAT register are set due to previous data transfers in the I²C bus (i.e., between master and other slaves); the following procedure can be used to receive valid data bytes:

1. When a valid slave address byte is detected, SI2CF bit is set and the I²C slave interrupt service routine is called; however, the RBF and I2COV bits are already set due to data transfers between other I²C nodes.
2. Check the status of the D_A flag and the I2COV flag in the I2CSTAT register when executing the I²C slave service routine.
3. If the D_A flag is cleared and the I2COV flag are set, an invalid data byte was received but a valid address byte was received. The overflow condition occurred because the I²C receive buffer was overflowing with previous I²C data transfers between other I²C nodes. This condition only occurs after a valid slave address was detected.
4. Clear the I2COV flag and perform a dummy read of the I²C receiver buffer, I2CRCV, to clear the RBF bit and recover the valid address byte. This action will also avoid the loss of the next data byte due to an overflow condition.
5. Verify that the recovered address byte matches the current slave address byte. If they match, the next data to be received is a valid data byte.
6. If the D_A flag and the I2COV flag are both set, a valid data byte was received and a previous valid data byte was lost. It will be necessary to code for handling this overflow condition.

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

5. Module: I/O

If the user application enables the auto-baud feature in the UART module, the I/O pin multiplexed with the IC1 (Input Capture) pin cannot be used as a digital input. However, the external interrupt function (INT1) can be used.

Work around

None.

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

dsPIC30F6011A/6012A/6013A/6014A

6. Module: I²C

If there are two I²C devices on the bus, one of them is acting as the Master receiver and the other as the Slave transmitter. If both devices are configured for 10-bit addressing mode, and have the same value in the A10 and A9 bits of their addresses, then when the Slave select address is sent from the Master, both the Master and Slave acknowledge it. When the Master sends out the read operation, both the Master and the Slave enter into Read mode and both of them transmit the data. The resultant data will be the ANDing of the two transmissions.

Work around

In all I²C devices, the addresses as well as bits A10 and A9 should be different.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

7. Module: Timer

When the timer is being operated in Asynchronous mode using the secondary oscillator (32.768 kHz) and the device is put into Sleep mode, a clock switch to any other oscillator mode before putting the device to Sleep prevents the timer from waking the device from Sleep.

Work around

Do not clock switch to any other oscillator mode if the timer is being used in Asynchronous mode using the secondary oscillator (32.768 kHz).

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

8. Module: PLL

The PLL LOCK Status bit (OSCCON<5>) can occasionally get cleared and generate an oscillator failure trap even when the PLL is still locked and functioning correctly.

Work around

The user application must include an oscillator failure trap service routine. In the trap service routine, first inspect the status of the Clock Failure Status bit (OSCCON<3>). If this bit is clear, return from the trap service routine immediately and continue program execution.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

9. Module: PSV Operations

An address error trap occurs in certain addressing modes when accessing the first four bytes of an PSV page. This only occurs when using the following addressing modes:

- MOV.D
- Register Indirect Addressing (word or byte mode) with pre/post-decrement

Work around

Do not perform PSV accesses to any of the first four bytes using the above addressing modes. For applications using the C language, MPLAB C30 version 3.11 or higher, provides the following command-line switch that implements a work around for the erratum.

```
-merrata=psv_trap
```

Refer to the `readme.txt` file in the MPLAB C30 v3.11 tool suite for further details.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

dsPIC30F6011A/6012A/6013A/6014A

10. Module: I²C

In 10-bit Addressing mode, some address matches don't set the RBF flag or load the receive register I2CxRCV, if the lower address byte matches the reserved addresses. In particular, these include all addresses with the form XX0000XXXX and XX1111XXXX, with the following exceptions:

- 001111000X
- 011111001X
- 101111010X
- 111111011X

Work around

Ensure that the lower address byte in 10-bit Addressing mode does not match any 7-bit reserved addresses.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

11. Module: I²C

When the I²C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02; however, the module acknowledges both address bytes.

Work around

None.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

12. Module: I²C

When the I²C module is enabled by setting the I2CEN bit in the I2CCON register, the dsPIC DSC device generates a glitch on the SDA and SCL pins. This glitch falsely indicates "Communication Start" to all devices on the I²C bus, and can cause a bus collision in a multi-master configuration.

Additionally, when the I2CEN bit is set, the S and P bits of the I²C module are set to values '1' and '0', respectively, which indicate a "Communication Start" condition.

Work arounds

To avoid this issue, either of the following two work arounds can be implemented, depending on the application requirements.

Work around 1:

In a single-master environment, add a delay between enabling the I²C module and the first data transmission. The delay should be equal to or greater than the time it takes to transmit two data bits.

In the multi-master configuration, in addition to the delay, all other I²C masters should be synchronized and wait for the I²C module to be initialized before initiating any kind of communication.

Work around 2:

In dsPIC DSC devices in which the I²C module is multiplexed with other modules that have precedence in the use of the pin, it is possible to avoid this glitch by enabling the higher priority module before enabling the I²C module.

Use the following procedure to implement this work around:

1. Enable the higher priority peripheral module that is multiplexed on the same pins as the I²C module.
2. Set up and enable the I²C module.

Disable the higher priority peripheral module that was enabled in step 1.

Note: Work around 2 works only for devices that share the SDA and SCL pins with another peripheral that has a higher precedence over the port latch, such as the UART. The priority is shown in the pin diagram located in the data sheet. For example, if the SDA and SCL pins are shared with the UART and SPI pins, and the UART has higher precedence on the port latch pin.

Affected Silicon Revisions

A2	B0	B1						
X	X	X						

dsPIC30F6011A/6012A/6013A/6014A

13. Module: CAN

CAN Receive filters 3, 4 and 5 may not work for a given combination of instruction cycle speed and CAN bit time quanta.

Work around

Do not use CAN RX filters 3, 4 and 5. Instead, use filters 0, 1 and 2.

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

14. Module: CPU

Sequential MAC class instructions, which prefetch data from Y data space using ± 4 address modification, will cause an address error trap. The trap occurs only when all of the following conditions are true:

1. Two sequential MAC class instructions (or a MAC class instruction executed in a REPEAT or DO loop) that prefetch from Y data space.
2. Both instructions prefetch data from Y data space using the $+ = 4$ or $- = 4$ address modification.
3. Neither of the instruction uses an accumulator write-back.

Work around

The problem described above can be avoided by using any of the following methods:

1. Inserting any other instruction between the two MAC class instructions.
2. Adding an accumulator write-back (a dummy write-back if needed) to either of the MAC class instructions.
3. Do not use the $+ = 4$ or $- = 4$ address modification.
4. Do not prefetch data from Y data space.

Affected Silicon Revisions

A2	B0	B1					
X							

15. Module: CPU

When a user executes a DISI #7, for example, this will disable interrupts for $7 + 1$ cycles ($7 +$ the DISI instruction itself). In this case, the DISI instruction uses a counter which counts down from 7 to 0. The counter is loaded with 7 at the end of the DISI instruction.

If the user code executes another DISI on the instruction cycle where the DISI counter has become zero, the new DISI count is loaded, but the DISI state machine does not properly re-engage and continue to disable interrupts. At this point, all interrupts are enabled. The next time the user code executes a DISI instruction, the feature will act normally and block interrupts.

In summary, it is only when a DISI execution is coincident with the current DISI count = 0, that the issue occurs. Executing a DISI instruction before the DISI counter reaches zero will not produce this error. In this case, the DISI counter is loaded with the new value, and interrupts remain disabled until the counter becomes zero.

Work around

When executing multiple DISI instructions within the source code, make sure that subsequent DISI instructions have at least one instruction cycle between the time that the DISI counter decrements to zero and the next DISI instruction. Alternatively, make sure that subsequent DISI instructions are called before the DISI counter decrements to zero.

Affected Silicon Revisions

A2	B0	B1					
X							

16. Module: Output Compare

A glitch will be produced on an output compare pin under the following conditions:

- The user software initially drives the I/O pin high using the Output Compare module or a write to the associated PORT register
- The Output Compare module is configured and enabled to drive the pin low at some point in later time (OCxCON = 0x0002 or OCxCON = 0x0003)

When these events occur, the Output Compare module will drive the pin low for one instruction cycle (TCY) after the module is enabled.

Work around

None. However, the user may use a timer interrupt and write to the associated PORT register to control the pin manually.

Affected Silicon Revisions

A2	B0	B1					
X							

dsPIC30F6011A/6012A/6013A/6014A

17. Module: OSC2 Pin

Table 3 shows the Table 20-2 from the “dsPIC30F6011A/6012A/6013A/6014A Data Sheet” (DS70143A), which lists the device clock operational modes. The data in the table is correct with the following exceptions:

- Digital I/O functionality is not operational in the FRC with PLL (4x, 8x and 16x PLL) Oscillator mode
- CLKOUT functionality is only supported if the EC or ERC Oscillator mode is actually selected as the device clock source

Work around

None. In future revisions of silicon, port pin RC15 may also be configured for Digital I/O and CLKOUT for additional oscillator modes.

Affected Silicon Revisions

A2	B0	B1					
X							

TABLE 3: CONFIGURATION BIT VALUES FOR CLOCK SELECTION

Oscillator Mode	Oscillator Source	FOS<2:0>			FPR<4:0>					OSC2 Function
ECIO w/ PLL 4x	PLL	1	1	1	0	1	1	0	1	I/O
ECIO w/ PLL 8x	PLL	1	1	1	0	1	1	1	0	I/O
ECIO w/ PLL 16x	PLL	1	1	1	0	1	1	1	1	I/O
FRC w/ PLL 4x	PLL	1	1	1	0	0	0	0	1	I/O
FRC w/ PLL 8x	PLL	1	1	1	0	1	0	1	0	I/O
FRC w/ PLL 16x	PLL	1	1	1	0	0	0	1	1	I/O
XT w/ PLL 4x	PLL	1	1	1	0	0	1	0	1	OSC2
XT w/ PLL 8x	PLL	1	1	1	0	0	1	1	0	OSC2
XT w/ PLL 16x	PLL	1	1	1	0	0	1	1	1	OSC2
HS2 w/ PLL 4x	PLL	1	1	1	1	0	0	0	1	OSC2
HS2 w/ PLL 8x	PLL	1	1	1	1	0	0	1	0	OSC2
HS2 w/ PLL 16x	PLL	1	1	1	1	0	0	1	1	OSC2
HS3 w/ PLL 4x	PLL	1	1	1	1	0	1	0	1	OSC2
HS3 w/ PLL 8x	PLL	1	1	1	1	0	1	1	0	OSC2
HS3 w/ PLL 16x	PLL	1	1	1	1	0	1	1	1	OSC2
ECIO	External	0	1	1	0	1	1	0	0	I/O
XT	External	0	1	1	0	0	1	0	0	OSC2
HS	External	0	1	1	0	0	0	1	0	OSC2
EC	External	0	1	1	0	1	0	1	1	CLKOUT
ERC	External	0	1	1	0	1	0	0	1	CLKOUT
ERCIO	External	0	1	1	0	1	0	0	0	I/O
XTL	External	0	1	1	0	0	0	0	0	OSC2
LP	Secondary	0	0	0	x	x	x	x	x	(Note 1,2)
FRC	Internal FRC	0	0	1	x	x	x	x	x	(Note 1,2)
LPRC	Internal LPRC	0	1	0	x	x	x	x	x	(Note 1,2)

Note 1: OSC2 pin function is determined by FPR<4:0>.

- Note 2:** OSC1 pin cannot be used as an I/O pin even if the secondary oscillator or an internal clock source is selected at all times.

dsPIC30F6011A/6012A/6013A/6014A

18. Module: LP Oscillator

The 32 kHz LP Oscillator module is not operational for this version of silicon.

Work around

None.

Affected Silicon Revisions

A2	B0	B1					
X							

19. Module: ADC

ADC event triggers from the INT0 pin will not wake-up the device from Sleep mode if the SMPI bits are non-zero. This means that if the ADC is configured to generate an interrupt after a certain number of INT0 triggered conversions, the ADC conversions will not be triggered and the device will remain in Sleep. The ADC will perform conversions and wake-up the device only if it is configured to generate an interrupt after each INT0 triggered conversion (SMPI<3:0> = 0000).

Work around

None. If ADC event trigger from the INT0 pin is required, initialize SMPI<3:0> to '0000' (interrupt on every conversion).

Affected Silicon Revisions

A2	B0	B1					
X							

20. Module: PLL

If 4x or 8x PLL mode is used, the input frequency range is 5 MHz-10 MHz instead of 4 MHz-10 MHz.

Work around

None. If 4x or 8x PLL is used, make sure the input crystal or clock frequency is 5 MHz or greater.

Affected Silicon Revisions

A2	B0	B1					
X							

21. Module: ADC

If the ADC module is in an enabled state when the device enters Sleep mode as a result of executing a PWRSAV #0 instruction, the device power-down current (IPD) may exceed the specifications listed in the device data sheet. This may happen even if the ADC module is disabled by clearing the ADON bit prior to entering Sleep mode.

Work around

In order to remain within the IPD specifications listed in the device data sheet, the user software must completely disable the ADC module by setting the ADC Module Disable bit in the corresponding Peripheral Module Disable (PMDx) register, prior to executing a PWRSAV #0 instruction.

Affected Silicon Revisions

A2	B0	B1					
X	X	X					

dsPIC30F6011A/6012A/6013A/6014A

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70143E):

Note: Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

1. Module: DC Characteristics: Operating MIPS vs. Voltage

The maximum MIPS values were stated incorrectly for certain voltages in Table 23-1 of the current device data sheet. The correct values are shown in **bold** type in [Table 4](#).

TABLE 4: OPERATING MIPS VS. VOLTAGE FOR dsPIC30F6010A

VDD Range (in Volts)	Temp Range (in °C)	Max MIPS	
		dsPIC30F6010A-30I	dsPIC30F6010A-20E
4.5-5.5	-40 to +85	30	—
4.5-5.5	-40 to +125	—	20
3.0-3.6	-40 to +85	20	—
3.0-3.6	-40 to +125	—	15
2.5-3.0	-40 to +85	10	—

2. Module: DC Characteristics: Operating Current (IDD)

Parameters DC27a and DC27b (3.3V @ 20 MIPS) were inadvertently removed from Table 23-5 of the current device data sheet. The correct values are shown in **bold** type in [Table 5](#).

TABLE 5: DC CHARACTERISTICS: OPERATING CURRENT (IDD)

DC CHARACTERISTICS			Standard Operating Conditions: 2.5V to 5.5V (unless otherwise stated) Operating temperature -40°C ≤TA ≤+85°C for Industrial -40°C ≤TA ≤+125°C for Extended			
Parameter No.	Typical ⁽¹⁾	Max	Units	Conditions		
Operating Current (IDD) ⁽²⁾						
DC27a	84	105	mA	25°C	3V	20 MIPS
DC27b	84	105	mA	85°C		
DC27d	140	180	mA	25°C	5V	
DC27e	138	180	mA	85°C		
DC27f	138	180	mA	125°C		

Note 1: Data in “Typ” column is at 5V, 25°C unless otherwise stated. Parameters are for design guidance only and are not tested.

2: The supply current is mainly a function of the operating voltage and frequency. Other factors such as I/O pin loading and switching rate, oscillator type, internal code execution pattern and temperature also have an impact on the current consumption. The test conditions for all IDD measurements are as follows: OSC1 driven with external square wave from rail to rail. All I/O pins are configured as Inputs and pulled to VDD. MCLR = VDD, WDT, FSCM, LVD and BOR are disabled. CPU, SRAM, Program Memory and Data Memory are operational. No peripheral modules are operating.

dsPIC30F6011A/6012A/6013A/6014A

3. Module: DC Characteristics: Operating Current (IDLE)

Parameters DC47a and DC47b (3.3V @ 20 MIPS) were inadvertently removed from Table 23-6 of the current device data sheet. The correct values are shown in **bold** type in [Table 6](#).

TABLE 6: DC CHARACTERISTICS: OPERATING CURRENT (IDLE)

DC CHARACTERISTICS			Standard Operating Conditions: 2.5V to 5.5V (unless otherwise stated) Operating temperature -40°C ≤TA ≤+85°C for Industrial -40°C ≤TA ≤+125°C for Extended			
Parameter No.	Typical ⁽¹⁾	Max	Units	Conditions		
Operating Current (IDD) ⁽²⁾						
DC47a	28	65	mA	25°C	3V	20 MIPS
DC47b	29	65	mA	85°C		
DC47d	48	110	mA	25°C	5V	
DC47e	49	110	mA	85°C		
DC47f	49	110	mA	125°C		

Note 1: Data in “Typ” column is at 5V, 25°C unless otherwise stated. Parameters are for design guidance only and are not tested.

2: Base IDLE current is measured with Core off, Clock on and all modules turned off.

dsPIC30F6011A/6012A/6013A/6014A

APPENDIX A: REVISION HISTORY

Rev A Document (4/2009)

Initial release of this document; issued for revision A2, B0 and B1 silicon.

Includes silicon issues 1 ([CPU](#)), 2 ([Output Compare](#)), 3 ([Sleep Mode](#)), 4 ([I²C](#)), 5 ([I/O](#)), 6 ([I²C](#)), 7 ([Timer](#)), 8 ([PLL](#)), 9 ([PSV Operations](#)), 10-12 ([I²C](#)), 13 ([CAN](#)), 14-15 ([CPU](#)), 16 ([Output Compare](#)), 17 ([OSC2 Pin](#)), 18 ([LP Oscillator](#)), 19 ([ADC](#)) and 20 ([PLL](#)).

This document replaces the following errata documents:

- DS80242, “dsPIC30F6011A/6012A/6013A/6014A Rev. A2 Silicon Errata”
- DS80303, “dsPIC30F6011A/6012A/6013A/6014A Rev. B0 Silicon Errata”
- DS80401, “dsPIC30F6011A/6012A/6013A/6014A Rev. B1 Silicon Errata”

Rev B Document (6/2010)

Added silicon issue 21 ([ADC](#)) and data sheet clarification 1 (DC Characteristics: I/O Pin Input Specifications).

Rev C Document (6/2011)

Removed previous data sheet clarification 1 and added new data sheet clarification 1 ([DC Characteristics: Operating MIPS vs. Voltage](#)), 2 ([DC Characteristics: Operating Current \(IDD\)](#)), and 3 ([DC Characteristics: Operating Current \(IIDL\)](#)).

dsPIC30F6011A/6012A/6013A/6014A

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC³² logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICKit, PICtail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2009-2011, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-61341-250-3

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2009 ==

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC[®] MCUs and dsPIC[®] DSCs, KEELOQ[®] code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland
Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara
Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto
Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Hangzhou
Tel: 86-571-2819-3180
Fax: 86-571-2819-3189

China - Hong Kong SAR
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama
Tel: 81-45-471-6166
Fax: 81-45-471-6122

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-6578-300
Fax: 886-3-6578-370

Taiwan - Kaohsiung
Tel: 886-7-213-7830
Fax: 886-7-330-9305

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820

05/02/11