

**Date:** 18 Feb 2012

**Product Category:** 8-bit Microcontrollers

**Device Family:**  

**Notification subject:** ERRATA - PIC12(L)F1822/PIC16(L)F1823 Silicon Errata and Data Sheet Clarification Errata Document Revision

**Notification text:** SYST-18YBGA236

Microchip has released a new DeviceDoc for the PIC12(L)F1822/PIC16(L)F1823 Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [PIC12\(L\)F1822/PIC16\(L\)F1823 Silicon Errata and Data Sheet Clarification](#).

**Notification Status:** Final

**Description of Change:** Adding Oscillator and EUSART Errata

**Pre Change:** N/A

**Post Change:** N/A

**Impacts to Data Sheet:** None

**Reason for Change:** To Improve Productivity

**Change Implementation Status:** Complete

**Date Document Changes Effective:** 18 Feb 2012

**NOTE:** Please be advised that this is a change to the document only the product has not been changed..

**Markings to Distinguish Revised from Unrevised Devices:**N/A

**Attachment(s):** [PIC12\(L\)F1822/PIC16\(L\)F1823 Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

**Terms and Conditions:**

If you wish to change your product/process change notification (PCN) profile please log on to our website at <http://www.microchip.com/PCN> sign into myMICROCHIP to open the myMICROCHIP home page, then select a profile option from the left navigation bar.

To opt out of future offer or information emails (other than product change notification emails), click here to go to [microchipDIRECT](#) and login, then click on the "My account" link, click on "Update profile" and un-check the box that states "Future offers or information about Microchip's products or services."

## **Product Change Notification - SYST-18YBGA236**

---

Parts Affected

PIC16F1823

PIC12F1822



# MICROCHIP PIC12(L)F1822/PIC16(L)F1823

## PIC12(L)F1822/PIC16(L)F1823 Family Silicon Errata and Data Sheet Clarification

The PIC12(L)F1822/PIC16(L)F1823 family devices that you have received conform functionally to the current Device Data Sheet (DS41413B), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the PIC12(L)F1822/PIC16(L)F1823 silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A8**).

Data Sheet clarifications and corrections start on [page 10](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers, and emulation tools, which are available at the Microchip corporate web site ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 3 or PICKIT™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 3 programmer/debugger or PICKIT™ 3.
2. From the main menu in MPLAB IDE, select *Configure>Select Device*, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (*Debugger>Select Tool*).
4. Perform a "Connect" operation to the device (*Debugger>Connect*). Depending on the development tool used, the part number and Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various PIC12(L)F1822/PIC16(L)F1823 silicon revisions are shown in [Table 1](#).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	DEVICE ID<13:0> <sup>(1),(2)</sup>		
	DEV<8:0>	Revision ID for Silicon Revision	
		A6	A8
PIC12F1822	10 0111 000	0 0110	0 1000
PIC12LF1822	10 1000 000	0 0110	0 1000
PIC16F1823	10 0111 001	0 0110	0 1000
PIC16LF1823	10 1000 001	0 0110	0 1000

**Note 1:** The Device ID is located in the configuration memory at address 8006h.

**2:** Refer to the "PIC16F/LF182X/PIC16F/LF1822 Memory Programming Specification" (DS41390) for detailed information on Device and Revision IDs for your specific device.

# PIC12(L)F1822/PIC16(L)F1823

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>	
				A6	A8
Oscillator	HS Oscillator	1.1	HS Oscillator min. VDD.	X	
Oscillator	HFINTOSC Ready/Stable bit	1.2	Bits remained set to '1' after initial trigger.	X	X
Oscillator	Clock Switching	1.3	Clock switching can cause a single corrupted instruction.	X	X
Oscillator	Oscillator Start-up Timer (OST) bit	1.4	OST bit remains set.	X	X
ADC	Analog-to-Digital Converter	2.1	ADC conversion does not complete.	X	
APFCON	Remappable T1Gate	3.1	T1Gate is not remappable.	X	
Enhanced Capture Compare PWM (ECCP)	Enhanced PWM	4.1	PWM 0% duty cycle direction change.	X	
Enhanced Capture Compare PWM (ECCP)	Enhanced PWM	4.2	PWM 0% duty cycle port steering.	X	
Clock Switching	OSTS Status Bit	5.1	Remains clear when 4xPLL enabled.	X	X
Timer1 Gate	T1Gate Toggle mode	6.1	T1Gate flip-flop does not clear.	X	X
In-Circuit Serial Programming™ (ICSP™)	Low-Voltage Programming	7.1	Bulk Erase not available with LVP.	X	
BOR	Wake-up from Sleep	8.1	Device may BOR Reset when waking-up from Sleep.	X	X
Enhanced Universal Synchronous Asynchronous Receiver (EUSART)	16-Bit High-Speed Asynchronous mode	9.1	Works improperly at maximum rate.	X	X
Enhanced Universal Synchronous Asynchronous Receiver (EUSART)	Auto-Baud Detect	9.2	Auto-Baud Detect may store incorrect count value in the SPBRG registers.	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

# PIC12(L)F1822/PIC16(L)F1823

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A8**).

### 1. Module: Oscillator

#### 1.1 HS Oscillator

The HS oscillator requires a minimum voltage of 3.0 volts (at 65°C or less) to operate at 20 MHz.

##### Work around

None.

##### Affected Silicon Revisions

A6	A8						
X							

#### 1.2 OSCSTAT bits: HFIOFR and HFIOFS

When HFINTOSC is selected, the HFIOFR and HFIOFS bits will become set when the oscillator becomes ready and stable. Once these bits are set, they become “stuck”, indicating that HFINTOSC is always ready and stable. If the HFINTOSC is disabled, the bits fail to be cleared.

##### Work around

None.

##### Affected Silicon Revisions

A6	A8						
X	X						

### 1.3 Clock Switching

When switching clock sources between INTOSC clock source and an external clock source, one corrupted instruction may be executed after the switch occurs.

This issue does not affect Two-Speed Start-up or the Fail-Safe Clock Monitor operation.

##### Work around

When switching from an external oscillator clock source, first switch to 16 MHz HFINTOSC. Once running at 16 MHz HFINTOSC, configure IRCF to run at desired internal oscillator frequency.

When switching from an internal oscillator (INTOSC) to an external oscillator clock source, first switch to HFINTOSC High-Power mode (8 MHz or 16 MHz). Once running from HFINTOSC, switch to the external oscillator clock source.

##### Affected Silicon Revisions

A6	A8						
X	X						

#### 1.4 Oscillator Start-up Timer (OST) bit

During the Two-Speed Start-up sequence, the OST is enabled to count 1024 clock cycles. After the count is reached, the OSTS bit is set, the system clock is held low until the next falling edge of the external crystal (LP, XT or HS mode), before switching to the external clock source.

When an external oscillator is configured as the primary clock and Fail-Safe Clock mode is enabled (FCMEN = 1), any of the following conditions will result in the Oscillator Start-up Timer (OST) failing to restart:

- MCLR Reset
- Wake from Sleep
- Clock change from INTOSC to Primary Clock

This anomaly will manifest itself as a clock failure condition for external oscillators which take longer than the clock failure time-out period to start.

##### Work around

None.

##### Affected Silicon Revisions

A6	A8						
X	X						

# PIC12(L)F1822/PIC16(L)F1823

## 2. Module: ADC

### 2.1 Analog-to-Digital Converter (ADC)


Under certain device operating conditions, the ADC conversion may not complete properly. When this occurs, the ADC Interrupt Flag (ADIF) does not get set, the GO/DONE bit does not get cleared and the conversion result does not get loaded into the ADRESH and ADRESL result registers.

#### Work around

Method 1: Select the dedicated RC oscillator as the ADC conversion clock source, and perform all conversions with the device in Sleep.

Method 2: Provide a fixed delay in software to stop the A-to-D conversion manually, after all 10 bits are converted, but before the conversion would complete automatically. The conversion is stopped by clearing the GO/DONE bit in software. The GO/DONE bit must be cleared during the last 1/2 TAD cycle, before the conversion would have completed automatically. Refer to Figure 1 for details.

**FIGURE 1: INSTRUCTION CYCLE DELAY CALCULATION EXAMPLE**

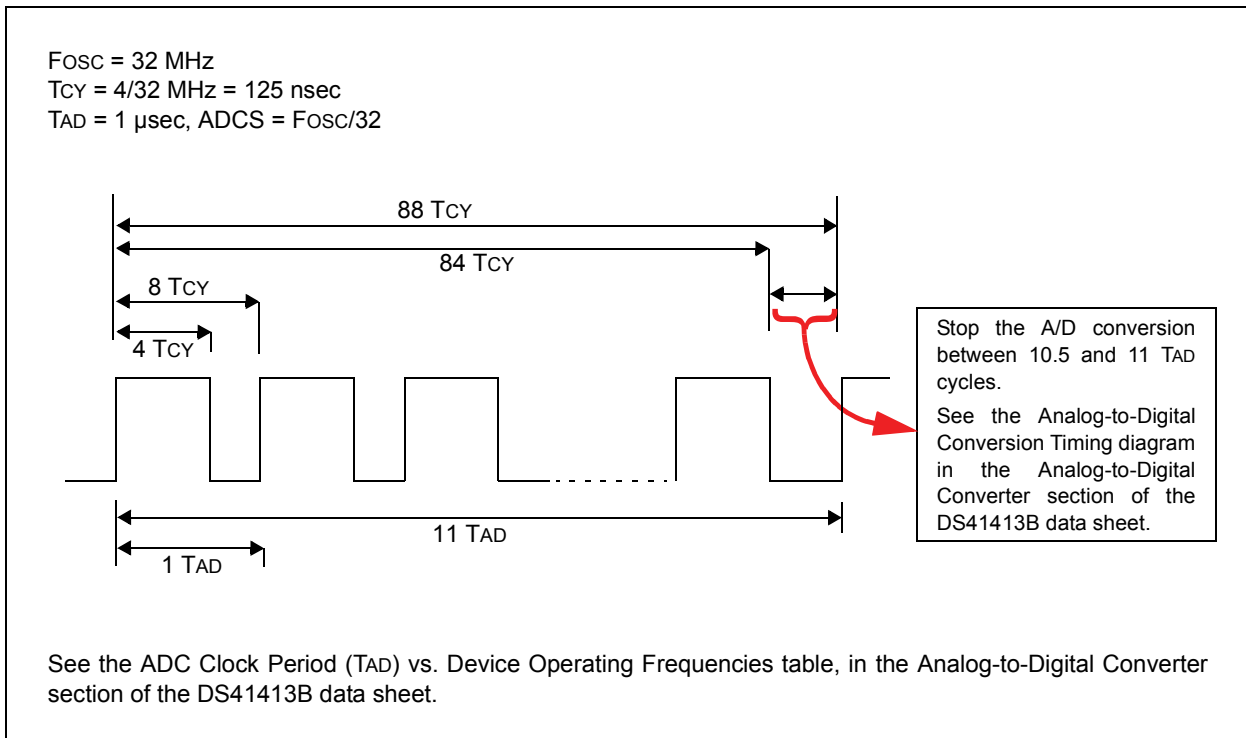

In Figure 1, 88 instruction cycles (TCY) will be required to complete the full conversion. Each TAD cycle consists of 8 TCY periods. A fixed delay is provided to stop the A/D conversion after 86 instruction cycles and terminate the conversion at the correct time as shown in the figure above.

**Note:** The exact delay time will depend on the choice of FOSC and the TAD divisor (ADCS) selection. The TCY counts shown in the timing diagram above apply to this example only. Refer to Table 3 for the required delay counts for other configurations.

#### EXAMPLE 1: CODE EXAMPLE OF INSTRUCTION CYCLE DELAY

```
BSF    ADCON0, GO/DONE; Start ADC conversion
                        ; Provide 86
                        ; instruction cycle
                        ; delay here
BCF    ADCON0, GO/DONE; Terminate the
                        ; conversion manually
MOVF   ADRESH, W      ; Read conversion
                        ; result
```

For other combinations of FOSC, TAD values and instruction cycle delay counts, refer to Table 3.

# PIC12(L)F1822/PIC16(L)F1823

**TABLE 3: INSTRUCTION CYCLE DELAY COUNTS FOR OTHER Fosc AND TAD COMBINATIONS**

Fosc	TAD	Instruction Cycle Delay Counts
32 MHz	Fosc/64	172
	Fosc/32	86
16 MHz	Fosc/64	172
	Fosc/32	86
	Fosc/16	43
8 MHz	Fosc/32	86
	Fosc/16	43

**Affected Silicon Revisions**

A6	A8						
X							

**3. Module: APFCON**

**3.1 Timer1 Gate**

The APFCON register is normally used to remap the T1 Gate to an alternate pin. The T1GSEL bit of the APFCON register is found to be not writable and therefore the T1Gate pin cannot be remapped. The default value for the T1GSEL bit is 0 and, therefore, the T1Gate will be found on RA4. This affects the PIC16(L)F1823 devices only.

**Work around**

None.

**Affected Silicon Revisions**

A6	A8						
X							

**4. Module: Enhanced Capture Compare PWM (ECCP)**

**4.1 Enhanced PWM**

When the PWM is configured for Full-Bridge mode and the duty cycle is set to 0%, writing the Pxm<1:0> bits to change the direction has no effect on PxA and PxC outputs.

**Work around**

Increase the duty cycle to a value greater than 0% before changing directions.

**Affected Silicon Revisions**

A6	A8						
X							

**4.2 Enhanced PWM**

In PWM mode, when the duty cycle is set to 0% and the STRxSYNC bit is set, writing the STRxA, STRxB, STRxC and the STRxD bits to enable/disable steering to port pins has no effect on the outputs.

**Work around**

Increase the duty cycle to a value greater than 0% before enabling/disabling steering to port pins.

**Affected Silicon Revisions**

A6	A8						
X							

**5. Module: Clock Switching**

**5.1 OST Status Bit**

When the 4xPLL is enabled, the Oscillator Start-up Time-out Status (OSTS) bit always remains clear.

**Work around**

None.

**Affected Silicon Revisions**

A6	A8						
X	X						

**6. Module: Timer1 Gate**

**6.1 Timer1 Gate Toggle mode**

When Timer1 Gate Toggle mode is enabled, it is possible to measure the full-cycle length of a Timer1 Gate signal. To perform this function, the Timer1 Gate source is routed through a flip-flop that changes state on every incrementing edge of the gate signal. Timer1 Gate Toggle mode is enabled by setting the T1GTM bit of the T1GCON register. When working properly, clearing either the T1GTM bit or the TMR1ON bit would also clear the output value of this flip-flop, and hold it clear. This is done in order to control which edge is being measured. The issue that exists is that clearing the TMR1ON bit does not clear the output value of the flip-flop and hold it clear.

**Work around**

Clear the T1GTM bit in the T1GCON register to clear and hold clear the output value of the flip-flop.

**Affected Silicon Revisions**

A6	A8						
X	X						



# PIC12(L)F1822/PIC16(L)F1823

## 7. Module: In-Circuit Serial Programming™ (ICSP™)

### 7.1 Low-Voltage Programming

The Bulk Erase feature is not available with Low-Voltage Programming mode.

A Bulk Erase of the program Flash memory or data memory cannot be executed in Low-Voltage Programming mode.

#### Work around

Method 1: If ICSP Low-Voltage Programming mode is required, use row erases to erase the program memory, as described in the Program/Verify mode section of the Programming Specification. Data memory must be overwritten with the desired values.

Method 2: Use the ICSP High-Voltage Programming mode if a Bulk Erase is required.

**Note:** Only the Bulk Erase feature will erase the program or data memory if the code or data protection is enabled. Method 2 must be used if the code or data protection is enabled.

#### Affected Silicon Revisions

A6	A8						
X							

## 8. Module: BOR

### 8.1 BOR Reset

This issue affects only the PIC12(L)F1822/PIC16(L)F1823 devices. The device may undergo a BOR Reset when waking-up from Sleep and BOR is re-enabled. A BOR Reset may also occur the moment the software BOR is enabled.

Under certain voltage and temperature conditions and when either SBODEN or BOR\_NSLEEP is selected, the devices may occasionally reset when waking-up from Sleep or BOR is enabled.

#### Work around

Method 1: In applications where BOR use is not critical, turn off the BOR in the Configuration Word.

Method 2: Set the FVREN bit of the FVRCON register. Maintain this bit on at all times.

Method 3: When BOR module is needed only during run-time, use the software-enabled BOR by setting the SBODEN option on the Configuration Word. BOR should be turned off by software before Sleep, then follow the below sequence for turning BOR on after Wake-up:

- a. Wake-up event occurs;
- b. Turn on FVR (FVREN bit of the FVRCON register);
- c. Wait until FVRRDY bit is set;
- d. Wait 15  $\mu$ s after the FVR Ready bit is set;
- e. Manually turn on the BOR.

Method 4: Use the software-enabled BOR as described in Method 3, but use the following sequence:

- a. Switch to internal 32 kHz oscillator immediately before Sleep;
- b. Upon wake-up, turn on FVR (FVREN bit of the FVRCON register);
- c. Manually turn on the BOR;
- d. Switch the clock back to the preferred clock source.

**Note:** When using the software BOR follow the steps in Methods 3 or 4 above when enabling BOR for the first time during program execution.

#### Affected Silicon Revisions

A6	A8						
X	X						

# PIC12(L)F1822/PIC16(L)F1823

## 9. Module: Enhanced Universal Synchronous Asynchronous Receiver (EUSART)

### 9.1 16-Bit High-Speed Asynchronous Mode

The EUSART provides unexpected operation when the 16-Bit High-Speed Asynchronous mode is selected and the Baud Rate Generator Data register values are loaded with zero (0). We do not recommend using this configuration for EUSART communication. The configuration is shown below in the following table:

Configuration Bits			BRG Data Registers	
SYNC	BRG16	BRGH	SPBRGH Value	SPBRGL Value
0	1	1	00000000	00000000

#### **Work around**

Ensure that the SPBRGH or the SPBRGL register is loaded with a non-zero value.

#### **Affected Silicon Revisions**

<b>A6</b>	<b>A8</b>						
X	X						

# PIC12(L)F1822/PIC16(L)F1823

## 9.2 Auto-Baud Detect

When using automatic baud detection (ABDEN), on occasion, an incorrect count value can be stored at the end of auto-baud detection in the SPBRGH:SPBRGL (SPBRG) registers. The SPBRG value may be off by several counts. This condition happens sporadically when the device clock frequency drifts to a frequency where the SPBRG value oscillates between two different values. The issue is present regardless of the baud rate Configuration bit settings.

### Work around

When using auto-baud, it is a good practice to always verify the obtained value of SPBRG, to ensure it remains within the application specifications. Two recommended methods are shown below.

For additional auto-baud information, see Technical Brief TB3069, "Use of Auto-Baud for Reception of LIN Serial Communications Devices: Mid-Range and Enhanced Mid-Range".

### **EXAMPLE 2: METHOD 1 – EUSART AUTO-BAUD DETECT WORK AROUND**

In firmware, define default, minimum and maximum auto-baud (SPBRG) values according to the application requirements.

For example, if the application runs at 9600 baud at 16 MHz then, the default SPBRG value would be (assuming 16-bit/Asynchronous mode) 0x67. The minimum and maximum allowed values can be calculated based on the application. In this example, a +/-5% tolerance is required, so tolerance is  $0x67 * 5\% = 0x05$ .

```
#define SPBRG_16BIT    *((*int)&SPBRG;                // define location for 16-bit SPBRG value

const int DEFAULT_BAUD = 0x0067;                    // Default Auto-Baud value
const int TOL = 0x05;                               // Baud Rate % tolerance
const int MIN_BAUD = DEFAULT_BAUD - TOL;           // Minimum Auto-Baud Limit
const int MAX_BAUD = DEFAULT_BAUD + TOL;           // Maximum Auto-Baud Limit
.
.
.
ABDEN = 1;                                           // Start Auto-Baud
while (ABDEN);                                       // Wait until Auto-Baud completes

if((SPBRG_16BIT > MAX_BAUD) || (SPBRG_16BIT < MIN_BAUD))
{
    SPBRG_16BIT = DEFAULT_BAUD;                     // Compare if value is within limits
                                                    // if out of spec, use DEFAULT_BAUD
}
.
.
.                                                    // if in spec, continue using the
                                                    // Auto-Baud value in SPBRG
```

# PIC12(L)F1822/PIC16(L)F1823

## EXAMPLE 3: METHOD 2 – EUSART AUTO-BAUD DETECT WORK AROUND

Similar to Method 1, define default, minimum and maximum auto-baud (SPBRG) values. In firmware, compute a running average of SPBRG. If the new SPBRG value falls outside the minimum or maximum limits, then use the current running average value (Average\_Baud), otherwise use the auto-baud SPBRG value and calculate a new running average.

For example, if the application runs at 9600 baud at 16 MHz then, the default SPBRG value would be (assuming 16-bit/ Asynchronous mode) 0x67. The minimum and maximum allowed values can be calculated based on the application. In this example, a +/-5% tolerance is required, so tolerance is  $0x67 * 5\% = 0x05$ .

```
#define SPBRG_16BIT    *((*int)&SPBRG;                // define location for 16-bit SPBRG value

const int DEFAULT_BAUD = 0x0067;                    // Default Auto-Baud value
const int TOL = 0x05;                               // Baud Rate % tolerance
const int MIN_BAUD = DEFAULT_BAUD - TOL;           // Minimum Auto-Baud Limit
const int MAX_BAUD = DEFAULT_BAUD + TOL;           // Maximum Auto-Baud Limit

int Average_Baud;                                    // Define Average_Baud variable
int Integrator;                                     // Define Integrator variable
.
.
.
Average_Baud = DEFAULT_BAUD;                        // Set initial average Baud rate
Integrator = DEFAULT_BAUD*15;                       // The running 16 count average
.
.
.
ABDEN = 1;                                          // Start Auto-Baud
while (ABDEN);                                     // Wait until Auto-Baud completes

Integrator+ = SPBRG_16BIT;
Average_Baud = Integrator/16;
if((SPBRG_16BIT > MAX_BAUD)|| (SPBRG_16BIT < MIN_BAUD))
{
    SPBRG_16BIT = Average_Baud;                    // Check if value is within limits
                                                    // If out of spec, use previous average
}
else
{
    Integrator+ = SPBRG_16BIT;                      // If in spec, calculate the running
    Average_Baud = Integrator/16;                  // average but continue using the
    Integrator- = Average_Baud;                    // Auto-Baud value in SPBRG
}
.
.
.
```

### Affected Silicon Revisions

A6	A8						
X	X						

# PIC12(L)F1822/PIC16(L)F1823

---

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS41413B):

<b>Note:</b> Corrections are shown in <b>bold</b> . Where possible, the original bold text formatting has been removed for clarity.
---

### 1. Module: Oscillator

#### 5.5 Fail-Safe Clock Monitor

##### 5.5.3 FAIL-SAFE CONDITION CLEARING

The Fail-Safe condition is cleared after a Reset, executing a `SLEEP` instruction or changing the SCS bits of the `OSCCON` register. When the SCS bits are changed, the OST is restarted. While the OST is running, the device continues to operate from the INTOSC selected in `OSCCON`. When the OST times out, the Fail-Safe condition is cleared **after successfully switching to the external clock source. The OSFIF bit should be cleared prior to switching to the external clock source. If the Fail-Safe condition still exists, the OSFIF flag will again become set by hardware**

## APPENDIX A: DOCUMENT REVISION HISTORY

### **Rev A Document (6/2010)**

Initial release of this document.

### **Rev B Document (11/2010)**

Updated errata to the new format; Added Silicon Revision A8; Added Module 5: Clock Switching.

### **Rev C Document (03/2011)**

Added Modules 6, 7 and 8.

### **Rev D Document (02/2012)**

Updated Table 1; Added Modules 1.2, 1.3 and 1.4; Added Module 9, EUSART; Other minor corrections.

Data Sheet Clarifications: Added Module 1, Oscillator.

# PIC12(L)F1822/PIC16(L)F1823

---

NOTES:

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC<sup>32</sup> logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICKit, PICtail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2010-2012, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 9781620760550

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949:2009 ==**

*Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC<sup>®</sup> MCUs and dsPIC<sup>®</sup> DSCs, KEELOQ<sup>®</sup> code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*





# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Cleveland**  
Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Indianapolis**  
Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8569-7000  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Chongqing**  
Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

**China - Hangzhou**  
Tel: 86-571-2819-3187  
Fax: 86-571-2819-3189

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Osaka**  
Tel: 81-66-152-7160  
Fax: 81-66-152-9310

**Japan - Yokohama**  
Tel: 81-45-471-6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-5778-366  
Fax: 886-3-5770-955

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-330-9305

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820

11/29/11