

Date: 04 Oct 2012

Product Category: 8-bit Microcontrollers

Device Family:  

Notification subject: ERRATA - PIC32MX1XX/2XX Family Silicon Errata and Data Sheet Clarification Errata Document Revision

Notification text: SYST-04WTDN312

Microchip has released a new DeviceDoc for the PIC32MX1XX/2XX Family Silicon Errata and Data Sheet Clarification of devices. If you are using one of these devices please read the document located at [PIC32MX1XX/2XX Family Silicon Errata and Data Sheet Clarification](#).

Notification Status: Final

Description of Change: 1) Added silicon issue 13 (Watchdog Timer). 2) Updated silicon issue 6 (ADC). 3) Updated note in Silicon DEVREV tables 1 and 2.

Pre Change: N/A

Post Change: N/A

Impacts to Data Sheet: None

Reason for Change: To Improve Productivity

Change Implementation Status: Complete

Date Document Changes Effective: 04 Oct 2012

NOTE: Please be advised that this is a change to the document only the product has not been changed..

Markings to Distinguish Revised from Unrevised Devices:N/A

Attachment(s): [PIC32MX1XX/2XX Family Silicon Errata and Data Sheet Clarification](#)

Please contact your local [Microchip sales office](#) with questions or concerns regarding this notification.

Terms and Conditions:

If you wish to change your product/process change notification (PCN) profile please log on to our website at <http://www.microchip.com/PCN> sign into myMICROCHIP to open the myMICROCHIP home page, then select a profile option from the left navigation bar.

To opt out of future offer or information emails (other than product change notification emails), click here to go to [microchipDIRECT](#) and login, then click on the "My account" link, click on "Update profile" and un-check the box that states "Future offers or information about Microchip's products or services."

Product Change Notification - SYST-04WTDN312

Parts Affected

PIC32MX110F016B
PIC32MX120F032D
PIC32MX120F032B
PIC32MX110F016D
PIC32MX210F016B
PIC32MX210F016D
PIC32MX220F032B
PIC32MX220F032D
PIC32MX110F016C
PIC32MX210F016C
PIC32MX120F032C
PIC32MX220F032C
PIC32MX230F064D
PIC32MX150F128D
PIC32MX250F128D
PIC32MX150F128B
PIC32MX130F064B
PIC32MX130F064D
PIC32MX230F064B
PIC32MX250F128B
PIC32MX230F064C
PIC32MX250F128C
PIC32MX130F064C
PIC32MX150F128C

PIC32MX1XX/2XX Family Silicon Errata and Data Sheet Clarification

The PIC32MX1XX/2XX family devices that you have received conform functionally to the current Device Data Sheet (DS61168D), except for the anomalies described in this document.


The errata described in this document will be addressed in future revisions of the PIC32MX1XX/2XX silicon.

Note: The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#) and [Table 2](#). The last column of each table represents the latest silicon revision for the devices listed. The silicon issues are summarized in [Table 3](#).

Data Sheet clarifications and corrections start on [page 6](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site (www.microchip.com).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB project.
3. Configure the MPLAB project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB you are using, do one of the following:
 - a) For MPLAB 8, select *Programmer > Reconnect*.
 - b) For MPLAB X, select *Window > Dashboard*, and then click the **Refresh Debug Tool Status** icon ().
5. Depending on the development tool used, the part number and the Device and Revision ID values appear in the **Output** window.

Note: If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various silicon revisions are provided in [Table 1](#) and [Table 2](#).

TABLE 1: SILICON DEVREV VALUES FOR DEVICES WITH 16/32 KB FLASH

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽¹⁾	
		A0	A1
PIC32MX110F016B	0x04A07053	0x0	0x1
PIC32MX110F016C	0x04A09053		
PIC32MX110F016D	0x04A0B053		
PIC32MX210F016B	0x04A01053		
PIC32MX210F016C	0x04A03053		
PIC32MX210F016D	0x04A05053		
PIC32MX120F032B	0x04A06053		
PIC32MX120F032C	0x04A08053		
PIC32MX120F032D	0x04A0A053		
PIC32MX220F032B	0x04A00053		
PIC32MX220F032C	0x04A02053		
PIC32MX220F032D	0x04A04053		

Note 1: Refer to the “**Memory Organization**” and “**Special Features**” chapters in the current Device Data Sheet (DS61168D) for detailed information on Device and Revision IDs for your specific device.

PIC32MX1XX/2XX

TABLE 2: SILICON DEVREV VALUES FOR DEVICES WITH 64/128 KB FLASH

Part Number	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽¹⁾	
		A0	A1
PIC32MX130F064B	0x04D07053	0x0	0x1
PIC32MX130F064C	0x04D09053		
PIC32MX130F064D	0x04D0B053		
PIC32MX230F064B	0x04D01053		
PIC32MX230F064C	0x04D03053		
PIC32MX230F064D	0x04D05053		
PIC32MX150F128B	0x04D08053		
PIC32MX150F128C	0x04D08053		
PIC32MX150F128D	0x04D0A053		
PIC32MX250F128B	0x04D00053		
PIC32MX250F128C	0x04D02053		
PIC32MX250F128D	0x04D04053		

Note 1: Refer to the “Memory Organization” and “Special Features” chapters in the current Device Data Sheet (DS61168D) for detailed information on Device and Revision IDs for your specific device.

TABLE 3: SILICON ISSUE SUMMARY

Module	Feature	Item #	Issue Summary	Affected Device		
				Flash Memory (KB)	Silicon Revision	
					A0	A1
Voltage Regulator	BOR	1.	Device may not exit Brown-out Reset (BOR) state if a BOR event occurs.	16/32	X	
				64/128	X	
Oscillator	Clock Switch	2.	If a Fail-Safe Clock Monitor (FSCM) event occurs when Primary Oscillator (POsc) mode is used, firmware clock switch requests to switch from FRC mode will fail.	16/32	X	X
				64/128	X	X
I ² C™	Slave Mode	3.	The I ² C module does not respond to address 0x78 when the STRICT and A10M bits are cleared in the I2CxCON register.	16/32	X	X
				64/128	X	X
USB	UIDLE Interrupt	4.	UIDLE interrupts cease if the UIDLE interrupt flag is cleared.	16/32	X	X
				64/128	X	X
ADC	—	5	The DNL parameter of the ADC module is not within the published data sheet specifications when the ADC module is operating at maximum conversion rate.	16/32	X	X
				64/128	X	X
ADC	CTMU Calibration	6.	Open selection for Channel 0 positive input is not functional.	16/32	X	X
				64/128		
ADC	Conversion Trigger from INT0 Interrupt	7.	The ADC module conversion triggers occur on the rising edge of the INT0 signal even when INT0 is configured to generate an interrupt on the falling edge.	16/32	X	X
				64/128	X	X
Parallel Master Port (PMP)	Address Pins	8.	When the Parallel Master Port (PMP) module is enabled, address pins cannot be used as GPIO output pins.	16/32	X	X
				64/128	X	X
I/O Ports	RA0 and RA1 Output	9.	Output High Voltage (VOH) on pins RA0 and RA1 is not within the published data sheet specification.	16/32	X	X
				64/128	X	X
CPU	Data Write to a Peripheral	10.	A data write operation by the CPU to a peripheral may be repeated if an interrupt occurs during initial write operation.	16/32	X	X
				64/128	X	X
Oscillator	Clock Out	11.	A clock signal is present on the CLK0 pin, regardless of the clock source and setting of the CLK0 Enable Configuration bit, during a Power-on Reset (POR) condition.	16/32	X	X
				64/128	X	X
Input Capture	Idle Mode and Sleep Mode	12.	All input capture modes selectable by ICM<2:0>, with the exception of Interrupt-only mode, will not work when the CPU enters Idle mode or Sleep mode.	16/32	X	X
				64/128	X	X
Watchdog Timer (WDT)	Windowed Mode	13.	The Watchdog Timer may issue a reset even if the user tries to clear the module within the allowed window.	16/32	X	X
				64/128	X	X

Legend: An 'X' indicates the issue is present in this revision of silicon;
 Shaded cells with an Em dash (‘—’) indicate that this silicon revision does not exist for this issue;
 Blank cells indicate an issue has been corrected in this revision of silicon.

PIC32MX1XX/2XX

Silicon Errata Issues

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. The table provided in each issue indicates which issues exist for a particular revision of silicon based on memory size.

1. Module: Voltage Regulator

Device may not exit the Brown-out Reset (BOR) state if a BOR event occurs.

Work arounds

Work around 1:

VDD must remain within the published specification (see parameter DC10 of the device data sheet).

Work around 2:

Reset the device by providing the Power-on Reset (POR) condition.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X					
64/128	X					

2. Module: Oscillator

If the Primary Oscillator (POSC) mode is implemented and a Fail-Safe Clock Monitor (FSCM) event occurs (failure of the external primary clock), the internal clock source will switch to the FRC oscillator. Subsequent firmware clock switch requests from the FRC oscillator to other clock sources will fail and the device will continue to execute on the FRC oscillator. On repair of the external clock source and a power-on state, the device will resume operation with the primary oscillator clock source.

Work around

None.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

3. Module: I²C™

The slave address, 0x78, is one of a group of reserved addresses. It is used as the upper byte of a 10-bit address when 10-bit addressing is enabled. The I²C module control register allows the programmer to enable both 10-bit addressing and strict enforcement of reserved addressing, with the A10M and STRICT bits, respectively. When both bits are cleared, the device should respond to the reserved address 0x78, but it does not.

Work around

None.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

4. Module: USB

If the bus has been idle for more than 3 ms, the IDLE interrupt flag is set. If software clears the interrupt flag and the bus remains idle, the IDLE interrupt flag will not be set again.

Work around

Software can leave the IDLE bit set until it has received some indication of bus resumption (i.e., Resume, Reset, SOF, or Error).

Note: Resume and Reset are the only interrupts that should be following IDLE assertion. If the IDLE bit is set, it should be okay to suspend the USB module (as long as this code is protected by the GUARD and/or ACTPEND logic). This will require software to clear the IDLE interrupt enable bit to exit the USB ISR (if using interrupt driven code).

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

5. Module: ADC

If the ADC module is configured to operate at a maximum conversion rate of 1.1 Msps, missing codes are possible every 2^5 codes and the DNL parameter will not be within the published specification.

Work around

Configure the ADC module to operate for a maximum conversion rate of 500 ksps.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

6. Module: ADC

If the ADC module is used in conjunction with the CTMU module in Absolute Capacitive/Time Measurement mode, Channel 0 positive input must remain open (CH0SA<3:0> = 1111 or CH0SB<3:0> = 1111) during the calibration step. However, open selection for Channel 0 positive input is not functional and connects this input to AVss.

Work around

Connect the ADC module to any unused pin and perform the CTMU calibration step. This connection will add a small amount of additional capacitance, but will have minimal impact on overall measurements.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128						

7. Module: ADC

When the ADC module is configured to start conversion on an external interrupt (SSRC<2:0> = 001), the start of conversion always occurs on a rising edge detected at the INT0 pin, even when the INT0 pin has been configured to generate an interrupt on a falling edge (INT0EP = 0).

Work around

Generate ADC conversion triggers on the rising edge of the INT0 signal.

Alternately, use external circuitry to invert the signal appearing at the INT0 pin, so that a falling edge of the input signal is detected as a rising edge by the INT0 pin.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

8. Module: Parallel Master Port (PMP)

If the PMP module is enabled, any pin with a PMP addressing capability (PMAx) cannot be used as a general purpose output pin, even when the corresponding PTEN<10:0> bit in the PMAEN register is cleared. All other functionality on these pins, including GPIO input functionality is not affected.

Work around

To use a GPIO pin as an output when this pin is shared with PMP addressing functionality and PMP is enabled, do the following:

1. Enable PMP addressing by setting the corresponding PTEN<10:0> bit in the PMAEN register.
2. Instead of using corresponding LATx registers to output GPIO data, use the PMADDR register.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

PIC32MX1XX/2XX

9. Module: I/O Ports

Output High Voltage (VOH) on pins RA0 and RA1 is not within the published data sheet specification if I2C1 module is enabled.

Work around

Disable slew rate control of the I2C1 module by setting the DISSLW bit (I2C1CON<9>).

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

10. Module: CPU

During normal operation, if a CPU write operation is interrupted by an incoming interrupt, it should be aborted (not completed) and resumed after the interrupt is serviced. However, some of these write operations may not be aborted, resulting in a double write to peripherals by the CPU (the first write during the interrupt and the second write after the interrupt is serviced).

Work around

Most peripherals are not affected by this issue, as a double write will not have a negative impact. However, the following communication peripherals will double-send data if their respective transmit buffers are written twice: SPI, I²C, UART and PMP. To avoid double transmission of data, utilize DMA to transfer data to these peripherals or disable interrupts while writing to these peripherals.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

11. Module: Oscillator

A clock signal is present on the CLK0 pin, regardless of the clock source and setting of the CLK0 Enable Configuration bit, OSCIOFNC (DEVCFG1<10>), during a Power-on Reset (POR) condition.

Work around

Do not connect the CLK0 pin to a device that would be adversely affected by rapid pin toggling or a frequency other than that defined by the oscillator configuration. Do not use the CLK0 pin as an input if the device connected to the CLK0 pin would be adversely affected by the pin driving a signal out.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

12. Module: Input Capture

All input capture modes selectable by ICM<2:0>, with the exception of Interrupt-only mode, will not work when the CPU enters Idle or Sleep mode.

Work around

Configure the Input Capture module for Interrupt-only mode (ICM<2:0> = 111) when the CPU is in Sleep or Idle mode.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

13. Module: Watchdog Timer (WDT)

When the Watchdog Timer module is used in Windowed mode, the module may issue a reset even if the user tries to clear the module within the allowed window.

Work around

None.

Affected Silicon Revisions

Device Flash Memory (KB)	Device Silicon Revision					
	A0	A1				
16/32	X	X				
64/128	X	X				

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS61168D):

<p>Note: Corrections are shown in bold. Where possible, the original bold text formatting has been removed for clarity.</p>

None to report at this time.

APPENDIX A: REVISION HISTORY

Rev A Document (10/2011)

Initial release of this document; issued for revision A0 silicon.

Includes silicon issues 1 ([Voltage Regulator](#)), 2 ([Oscillator](#)), 3 ([I²C™](#)), 4 ([USB](#)), 5 ([ADC](#)), 6 ([ADC](#)), 7 ([ADC](#)), 8 ([Parallel Master Port \(PMP\)](#)), and 9 ([I/O Ports](#)).

Rev B Document (2/2012)

Added silicon revision A1 for 16/32 KB Flash devices.

Added 64/128 KB Flash devices.

Added silicon issues 10 ([CPU](#)) and 11 ([Oscillator](#)).

Rev C Document (4/2012)

Updated silicon issue 10 ([CPU](#)).

Added silicon issue 12 ([Input Capture](#)).

Rev D Document (10/2012)

Updated silicon issue 6 ([ADC](#)).

Added silicon issue 13 ([Watchdog Timer \(WDT\)](#)).

Updated the note in the Silicon DEVREV Values tables (see [Table 1](#) and [Table 2](#)).

PIC32MX1XX/2XX

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, FlashFlex, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC³² logo, rPIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MTP, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.


Analog-for-the-Digital Age, Application Maestro, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniclient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICkit, PICTail, REAL ICE, rLAB, Select Mode, SQI, Serial Quad I/O, Total Endurance, TSHARC, UniWinDriver, WiperLock, ZENA and Z-Scale are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

GestIC and ULPP are registered trademarks of Microchip Technology Germany II GmbH & Co. & KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2011-2012, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-62076-609-5

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
= ISO/TS 16949 =**

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC[®] MCUs and dsPIC[®] DSCs, KEELOQ[®] code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland
Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara
Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto
Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Hangzhou
Tel: 86-571-2819-3187
Fax: 86-571-2819-3189

China - Hong Kong SAR
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Osaka
Tel: 81-66-152-7160
Fax: 81-66-152-9310

Japan - Yokohama
Tel: 81-45-471-6166
Fax: 81-45-471-6122

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung
Tel: 886-7-536-4818
Fax: 886-7-330-9305

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820

11/29/11