
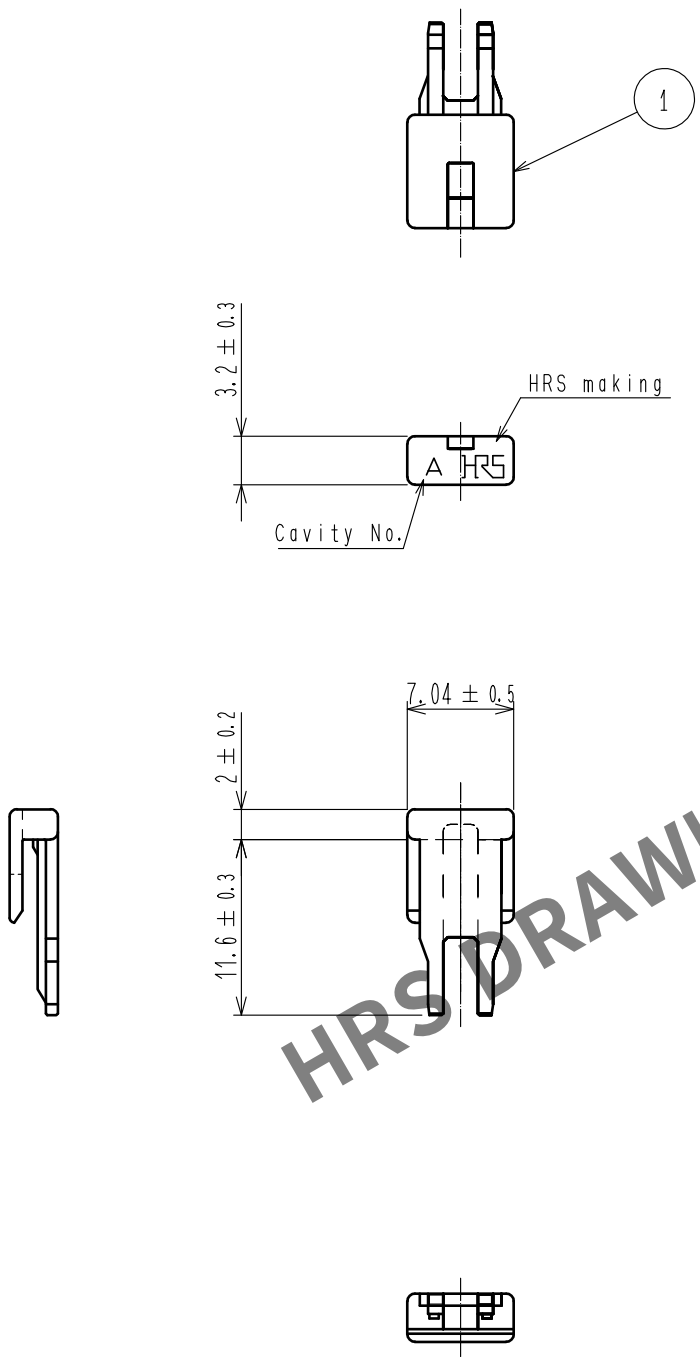


Jun.1.2026 Copyright 2026 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.



Note 1. Per pack : 100 pieces.

△ (Delete)

				1	Polyamide		Black, UL94V-0							
NO.	MATERIAL		FINISH .		REMARKS		NO.	MATERIAL		FINISH .		REMARKS		
UNITS mm			SCALE 2 : 1		COUNT 3	DESCRIPTION OF REVISIONS DIS-H-00012899			DESIGNED TS. KUMAZAWA		CHECKED SZ. ONO		DATE 20220228	
 HIROSE ELECTRIC CO., LTD.			APPROVED : HS. OKAWA			20191125	DRAWING NO.	EDC-390347-00-00						
			CHECKED : SZ. ONO			20191125	PART NO.	DF22B/C-1RS/P-7. 92						
			DESIGNED : TS. KUMAZAWA			20191125	CODE NO.	CL0680-1214-0-00						
			DRAWN : TS. KUMAZAWA			20191125		 1/3						


Jun.1.2026 Copyright 2026 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.




Precautions

Notification for harness assembly

- 1) When inserting the crimping terminal to the crimping socket, please do not tilt the crimping terminal or twist the cable.
Insertion at tilted angles or twisting the cable may cause deformation of the crimping terminal or crimping socket.
- 2) After inserting the crimping terminal to the crimping socket, please make sure that the lance has been hooked with pulling the cable lightly.
When checking the hook, please avoid bending the cable for preventing terminal drop-off.

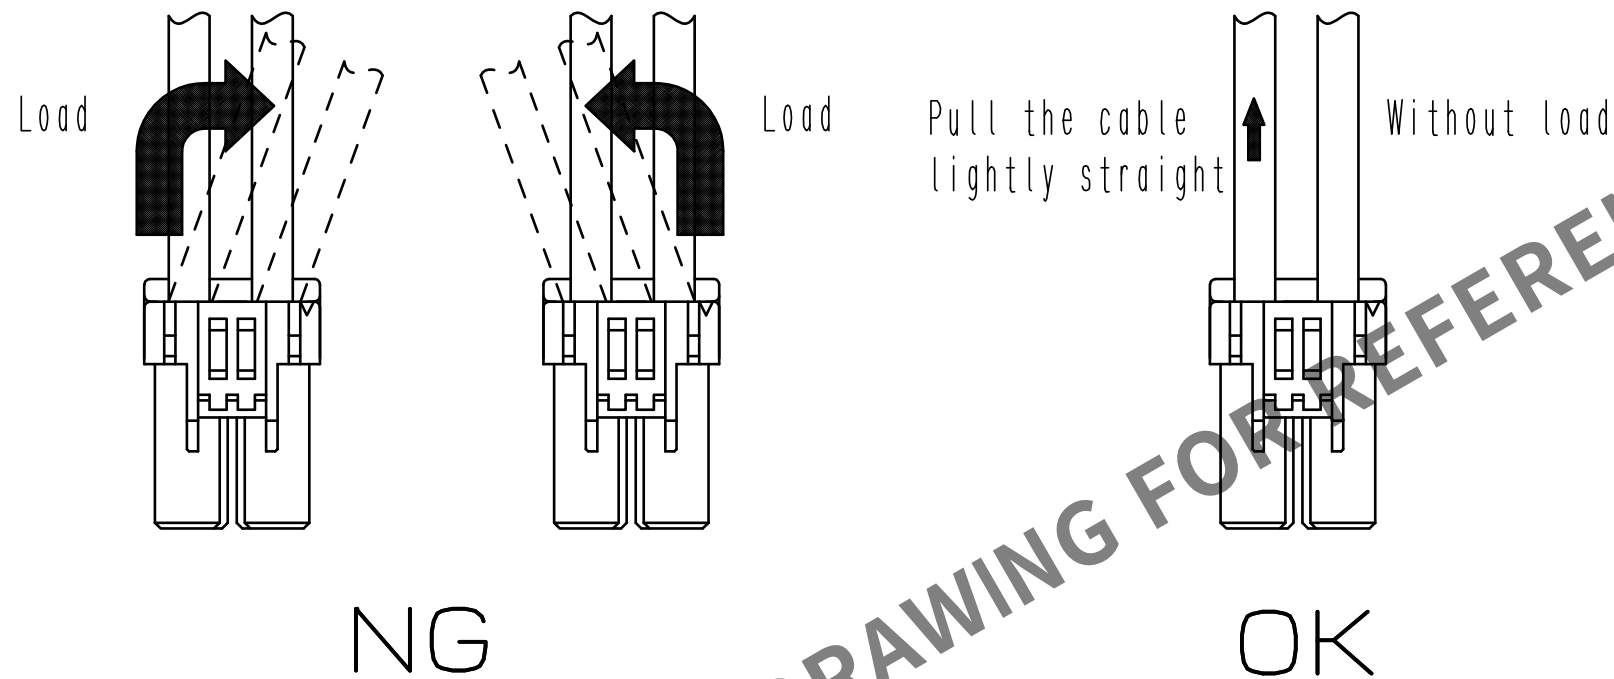

- 3) Bundle cables/Cable Cables
Recommend bundle and strip position of cables are 100 mm or more.
Bundling close to the connectors may cause terminal drop off, breaking cables and unstable connection.

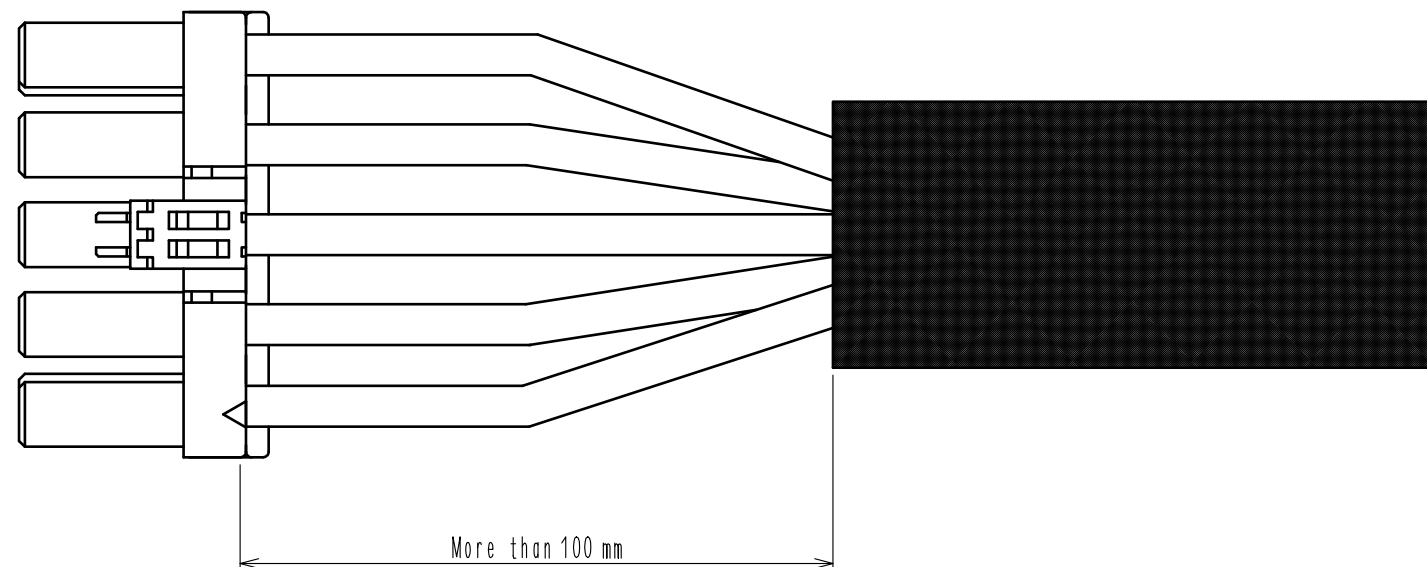

HRS


DRAWING NO.	EDC-390347-00-00
PART NO.	DF22B/C-1RS/P-7. 92
CODE NO.	CL0680-1214-0-00

Precautions


Notification for Insertion/Extraction

- 1) Please insert(extract) the crimping socket straight to the mating connector.
Insertion(extraction) at tilted angles applies load concentration to the connector end and may cause deformation (at connection area, socket and header case, etc). There is firing risk using this kind of deformed connector.


Insertion(Extraction)

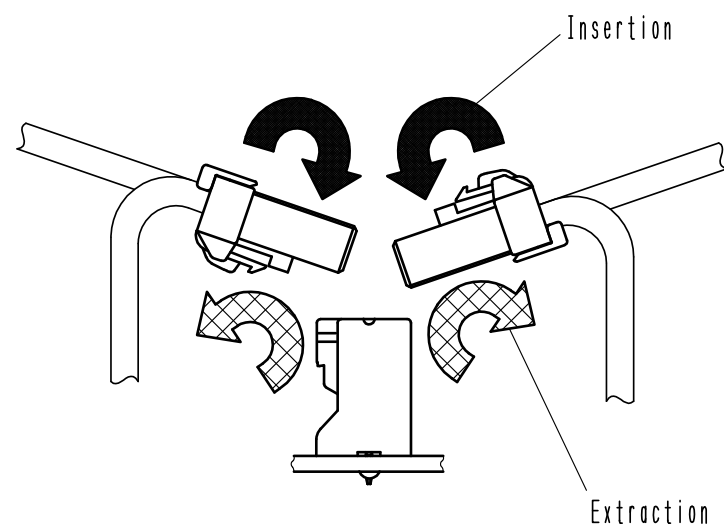

NG

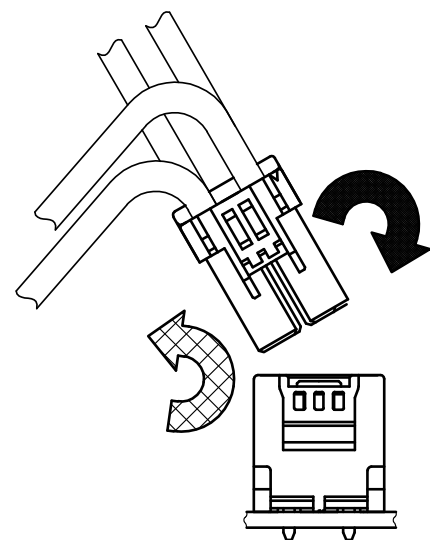

NG

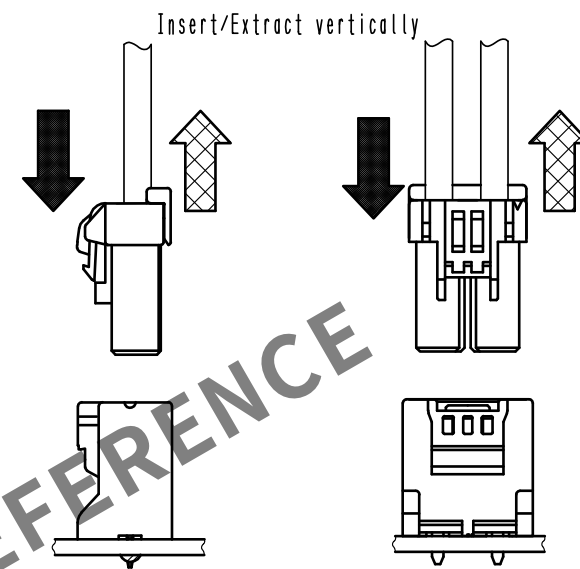


OK


- 2) When it is hard to extract, please lightly insert the connector beforehand and then pull it with releasing the lock.
Forced extraction has a risk of connector breakage.

Notification of wiring

- 1) When using a thick cable, short cable length and bending close to the connector end, these load concentration may cause deformation.
Please note that there is firing risk using deformed connector.
When installing, please refrain from stress concentration such as cable bending close to the connector end or cable twisting.

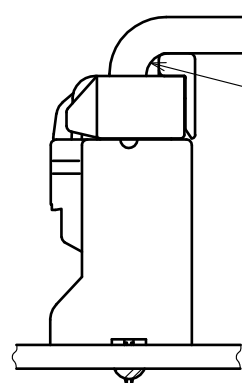

NG

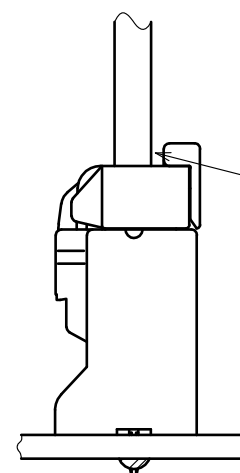

OK

HRS

DRAWING NO.	EDC-390347-00-00
PART NO.	DF22B/C-1RS/P-7. 92
CODE NO.	CL0680-1214-0-00