

Product Change Notification

520 Park East Blvd., New Albany, IN 47150 U.S.A (812)-944-6733 / 1-800-SAMTEC9

1. ECN #: 260944

2. Date of Announcement: November 11, 2015

3. Series:

• SMP - SMP ST JACK FOR RF25S CABLE - 50 OHM

4. Part #'s Affected


• SMP-PX-P-XX-ST-EM3


5. Description of Change:

The print is being updated to better reflect how product is being shipped. The portion of the connector which rests inside a cutout on the board increases from 4.06mm to 4.10mm on the print. The recommended PCB layout connector cutout region being suggested changes from 4.19mm to 4.23mm to account for the adjusted connector width.

6. Method of Identifying Change

There is no change to the physical product that is being shipped. This print change better reflects what parts have been shipped as.

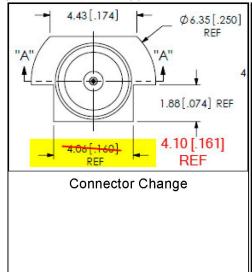

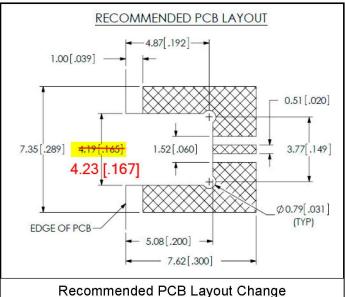

7. Reason for Change:

Product has generally been built towards to upper end of the 4.06mm specification to avoid a thin wall condition near the interface. The print is being updated to better reflect how actual product is being built and the recommended PCB layout is adjusted to account for this increase.

8. Impact of Change on Form, Fit, or Function:

- Fit The portion of the connector which rests in the PCB cutout increases from 4.06mm to 4.10mm.
- Fit The recommended PCB layout cutout region increases from 4.19mm to 4.23mm.

9. Projected Implementation Date: December 08, 2015