

# **Short Barrel Inductive Prox**

**E2E 2-WIRE AC** 

## Short Barrel 2-Wire AC Prox Sensors Meet IP67

- Thick nickel-plated brass barrel has wrench flats for easy installation
- Solid potted internal circuitry withstands shocks and water washdown to IP67
- High visibility indicator
- Choose prewired models with or without short-circuit protection and connector models



# Ordering Information \_\_\_\_\_

### **■ PREWIRED SENSORS WITHOUT SHORT-CIRCUIT PROTECTION**

WHEN ORDERING, PLEASE NOTE: Omron has added the suffix "-N" to E2E part numbers for ordering purposes only; the suffix "-N" will not appear on the product.

Туре	Size Sensing distance		Part number		
			NO	NC	
Shielded	M8	1.5 mm	E2E-X1R5Y1-N	E2E-X1R5Y2-N	
	M12	2 mm	E2E-X2Y1-US-N	E2E-X2Y2-US-N	
	M18	5 mm	E2E-X5Y1-US-N*	E2E-X5Y2-US-N	
	M30	10 mm	E2E-X10Y1-US-N*	E2E-X10Y2-US-N	
Unshielded	M8	2 mm	E2E-X2MY1-US-N*	E2E-X2MY2-US-N	
	M12	5 mm	E2E-X5MY1-US-N*	E2E-X5MY2-US-N*	
	M18	10 mm	E2E-X10MY1-US-N*	E2E-X10MY2-US-N*	
	M30	18 mm	E2E-X18MY1-US-N*	E2E-X18MY2-US-N	

<sup>\*</sup>Note: A different oscillating frequency is available to prevent mutual interference. Add a "5" to the part number (e.g., E2E-X5Y15-US-N).

## **■ PREWIRED SENSORS WITH SHORT-CIRCUIT PROTECTION**

Туре	Size	Sensing distance	Part number	
			NO	NC
Shielded	M18	5 mm	E2E-X5Y1-53-US	E2E-X5Y2-53-US
	M30	10 mm	E2E-X10Y1-53-US	E2E-X10Y2-53-US
Unshielded	M18	10 mm	E2E-X10MY1-53-US	E2E-X10MY2-53-US
	M30	18 mm	E2E-X18MY1-53-US	E2E-X18MY2-53-US

## ■ SENSORS WITH BUILT-IN CONNECTORS

Connector	Туре	Size	Sensing distance	Part number		
				NO	NC	
4-pin connector	Shielded	M12	2 mm	E2E-X2Y1-M1-N	E2E-X2Y2-M1-N	
(M12) See Note 1.		M18	5 mm	E2E-X5Y1-M1-N	E2E-X5Y2-M1-N	
		M30	10 mm	E2E-X10Y1-M1-N	E2E-X10Y2-M1-N	
	Unshielded	M12	5 mm	E2E-X5MY1-M1-N	E2E-X5MY2-M1-N	
		M18	10 mm	E2E-X10MY1-M1-N	E2E-X10MY2-M1-N	
		M30	18 mm	E2E-X18MY1-M1-N	E2E-X18MY2-M1-N	
3-pin connector	Shielded	M12	2 mm	E2E-X2Y1-M4	E2E-X2Y2-M4	
(M12) See Note 2.		M18	5 mm	E2E-X5Y1-M4	E2E-X5Y2-M4	
		M30	10 mm	E2E-X10Y1-M4	E2E-X10Y2-M4	
	Unshielded	M12	5 mm	E2E-X5MY1-M4	E2E-X5MY2-M4	
		M18	10 mm	E2E-X10MY1-M4	E2E-X10MY2-M4	
		M30	18 mm	E2E-X18MY1-M4	E2E-X18MY2-M4	

Note: 1. Use Omron's Y96E-44□A□ connector cordsets.

2. Use Omron's Y96E-33□A□ connector cordsets.

## ■ ACCESSORIES

Description		Part number	
Mounting brackets	Fits M8 size sensors Fits M12 size sensors Fits M18 size sensors Fits M30 size sensors	Y92E-B8 Y92E-B12 Y92E-B18 Y92E-B30	
Silicone rubber covers for shielded sensors	Fits M12 size sensors Fits M18 size sensors Fits M30 size sensors	Y92E-E12-2 Y92E-E18-2 Y92E-E30-2	
Connector cordsets	See Y96E Connector Cordsets data sheet for details		

## ■ REPLACEMENT PARTS

Description	Part number	
Mounting hardware including one pair of	Fits M8 size sensors	M8-MHWS
metal nuts and one washer	Fits M12 size sensors	M12-MHWS
	Fits M18 size sensors	M18-MHWS
	Fits M30 size sensors	M30-MHWS

# Specifications

## ■ SENSORS WITHOUT SHORT-CIRCUIT PROTECTION (E2E-X□Y□)

Part number	E2E-X1R5Y□-N	E2E-X2MY□-N	E2E-X2Y□ -US-N	E2E-X5MY □-US-N	E2E-X5Y □-US-N	E2E-X10MY □-US-N	E2E-X10Y □-US-N	E2E-X18MY □-US-N	
Size	M8		M12		M18	M18		M30	
Туре	Shielded	Unshielded	Shielded	Unshielded	Shielded	Unshielded	Shielded	Unshielded	
Sensing distance	1.5 mm (0.06 in) ±10%	2 mm (0.08 in) ±10%	2 mm (0.08 in) ±10%	5 mm (0.20 in) ±10%	5 mm (0.20 in) ±10%	10 mm (0.39 in) ±10%	10 mm (0.39 in) ±10%	18 mm (0.71 in) ±10%	
Supply voltage (operating voltage range) (See note 1)	24 to 240 VAC,	50/60 Hz (20 to 2	264 VAC)						
Current consumption	n 1.7 mA max.								
Sensing object	Magnetic metals	(refer to <i>Engine</i>	eering Data fo	r non-magnet	tic metals)				
Setting distance	0 to 1.2 mm (0 to 0.05 in)	0 to 1.6 mm (0 to 0.06 in)	0 to 1.6 mm (0 to 0.06 in)	0 to 4.0 mm (0 to 0.16 in)	0 to 4.0 mm (0 to 0.16 in)	0 to 8.0 mm (0 to 0.31 in)	0 to 8.0 mm (0 to 0.31 in)	0 to 14.0 mm (0 to 0.55 in)	
Standard object (mild steel)	8 x 8 x 1 mm (0.31 x 0.31 x 0.04 in)	12 x 12 x 1 mm (0.47 x 0.47 x 0.04 in)	12 x 12 x 1 mm (0.47 x 0.47 x 0.04 in)	15 x 15 x 1 mm (0.59 x 0.59 x 0.04 in)	18 x 18 x 1 mm (0.71 x 0.71 x 0.04 in)	30 x 30 x 1 mm (1.18 x 1.18 x 0.04 in)	30 x 30 x 1 mm (1.18 x 1.18 x 0.04 in)	54 x 54 x 1 mm (2.13 x 2.13 x 0.04 in)	
Differential travel	10% max. of ser	nsing distance	•	•	•	•	•	•	
Response frequence	y 25 Hz								
Operation (with sensing object approaching)	Y1 models: Load Y2 models: Load	-							
Control output (switching capacity)	5 to 100 mA ma	х.	5 to 200 mA	5 to 200 mA max. 5 to 300 mA max.					
Indicator	Operation indica	itor (red LED)							
Ambient temperatur (See note 2)	Operating: -25°( (-13°F to 158°F) with no icing		Operating: -40°C to 85°C (-40°F			35°F) with no i	icing		
Ambient humidity	Operating: 35%	to 95%	•						
Temperature influence	±15% max. of se ±10% max. of se								
Voltage influence	±1% max. of ser	±1% max. of sensing distance in rated voltage range ±15%							
Residual voltage	Refer to Engine	Refer to Engineering Data							
Insulation resistanc	e $\int 50  \text{M}\Omega  \text{min.}$ (at §	50 M $\Omega$ min. (at 500 VDC) between current carry parts and case							
Dielectric strength	4,000 VAC for 1	4,000 VAC for 1 min between current carry parts and case (2,000 VAC for M8 types)							
Vibration resistance	10 to 55 Hz, 1.5	-mm double amp		-	•				
Shock resistance	500 m/s <sup>2</sup> (appro times each in X,	,	1,000 m/s <sup>2</sup> 500 m/s <sup>2</sup> (a	(approx. 50G) pprox. 50G) f	) for 10 times or E2E-X5M	each in X, Y,	and Z axes		
Enclosure IEC	IP67								
rating NEMA	1, 4, 6, 12, 13								

Note: 1. When using an M18 or M30 size E2E at an ambient temperature between 70°C and 85°C (158°F and 185°F), make sure that the E2E has a control output of 200 mA maximum.

(This table continues on the next page.)

<sup>2.</sup> When supplying 24 VAC to any of the above models, make sure that the operating ambient temperature range is -25°C to 85°C (-13°F to 185°F).

Specifications Table - continued from previous page

Part number	er	E2E-X1R5Y         E2E-X2MY         E2E-X2Y           □-N         □-N         US-N		E2E-X2Y□- US-N	E2E-X5MY□ -US-N	E2E-X5Y□- US-N	E2E-X10MY □-US-N	E2E-X10Y □-US-N	E2E-X18MY □-US-N
Approvals	UL	<ul> <li>Recognized, File Numbe</li> </ul>		File Number E	r E76675				
	CSA	_		Certified, File Number LR45951					
Weight	Prewired	Approx. 45 g	oprox. 45 g Approx. 120 g		g	Approx. 160 g		Approx. 270 g	
	Connector		Approx. 25 g			Approx. 45 g		Approx. 125 g	Approx. 124 g
Material	Body	Stainless steel		Brass					
	Sensing face	PBT	РВТ						

## ■ SENSORS WITH SHORT-CIRCUIT PROTECTION (E2E-X□Y□-53-US)


Part nun	nber		E2E-X5Y□-53-US	E2E-X10MY□-53-US	E2E-X10Y□-53-US	E2E-X18MY□-53-US			
Body		Size	M18	•	M30	•			
		Туре	Shielded	Unshielded	Unshielded Shielded U				
Supply v	oltage		90 to 140 VAC, 50/60 H	Hz					
	maximur ndard tar	n detecting distance get)	5 mm (0.20 in) ±10%	10 mm (0.40 in) ±10%		18 mm (0.71 in) ±10%			
Usable of target)	detecting i	range (with standard	0 to 4 mm (0 to 0.16 in)	0 to 8 mm (0 to 0.31 in)		0 to 14 mm (0 to 0.55 in)			
	d target si el, L x W		18 x 18 x 1 mm (0.71 x 0.71 x 0.04 in)	30 x 30 x 1 mm (1.18 x 1.18 x 0.04 in)		54 x 54 x 1 mm (2.13 x 2.13 x 0.04 in)			
Different	ial travel		10% max. of effective of	detecting distance					
Control output	AC solid	Туре	SCR-NO (E2E-X	•					
	state	Max. load	300 mA						
		Min. load	5 mA						
		Max. offstate leakage current	1.5 mA (See "Leakage	1.5 mA (See "Leakage Current Characteristics" graph in <i>Engineering Data</i> .)					
		Max. on-state voltage drop	(See "Leakage Current Characteristics" graph in Engineering Data.)						
Respons	se frequer	ncy	25 Hz						
Circuit		Output short-circuit	Provided						
protection	on	Weld field immunity	Not provided						
		RFI immunity	Not provided						
Indicator	rs		Target present (red LED)						
Materials	S	Housing	Nickel-plated brass						
		Sensing face	Plastic						
		Cable sheath	Plastic						
Mounting	g		Two lock washers and Bracket Y92E-B18 opti		Two lock washers and Bracket Y92E-B30 opt				
Connect	ions	Prewired	2-conductor cable, 2 m	(6.56 ft) length					
Weight v	vith cable		Approx. 160 g (5.6 oz.)	)	Approx. 270 g (9.5 oz.	)			
Enclosu	re	UL	1						
ratings	ratings NEMA		1, 4, 6, 12, 13						
		IEC 144	IP67						
Approva	ls	UL	Recognized, File Number E76675						
		CSA	Certified, File Number LR45951						
Ambient	operating	temperature	-25° to 70°C (-13° to 158°F)						
Vibration	1		10 to 55 Hz, 1.5 mm (0.06 in) double amplitude						
Shock			Approx. 100 G's						

# Operation

### **■ OUTPUT CIRCUITS**


Sensors without Short-Circuit Protection (E2E-X□Y□)

### E2E-X□Y□-N AC 2-wire Models




### **AC 2-wire Models**

### E2E-X□Y□-N





### Sensors with Short-Circuit Protection (E2E-X□Y□-US-53)

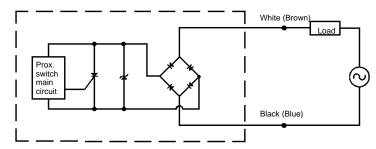

Note: IEC colors are shown in parenthesis

### With Short-Circuit Protection

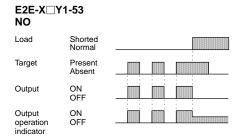

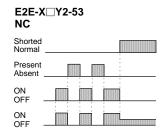

#### **Short-Circuit Indication**

The LED dims when the load is shorted and the load output immediately turns off and remains off until the short-circuit protection is reset.

### **Resetting Short-Circuit Protection**

Before the short-circuit protection can be reset, the short must be repaired. We recommend turning the power off before repairing the short. If this approach is taken, no further action is required to reset the short-circuit protection.

If the short must be repaired with power on, the following resetting steps are required:

For NO sensors, the target must be removed to reset the short-circuit protection.


For NC sensors, the target must be presented then removed to reset the short-circuit protection.


# **Engineering Data**

## **■** OPERATING RANGE (TYPICAL)

### **Shielded Models**


E2E-X□Y□-N

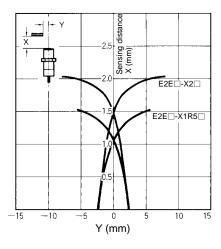


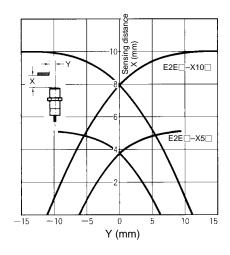

### **Unshielded Models**


E2E-X MY -N

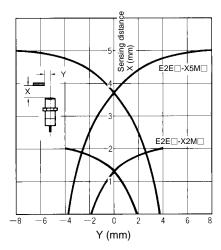

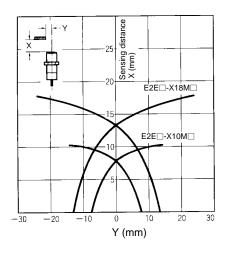


## **■ LEAKAGE CURRENT (TYPICAL)**


E2E-X□Y□-N

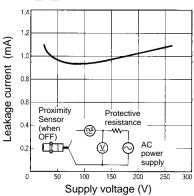



E2E-X Y -53-US

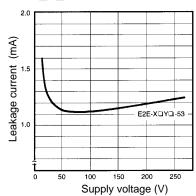


## ■ RESIDUAL OUTPUT VOLTAGE (TYPICAL)

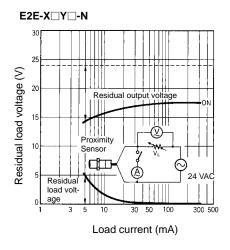


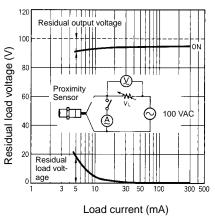


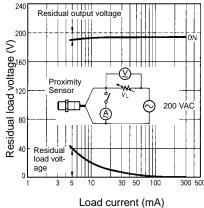



## ■ SENSING DISTANCE VS. SENSING OBJECT (TYPICAL)

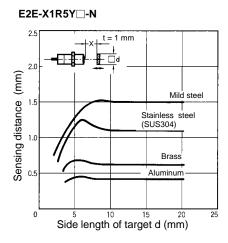


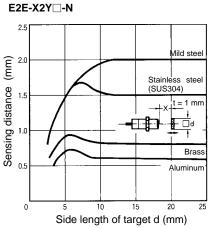

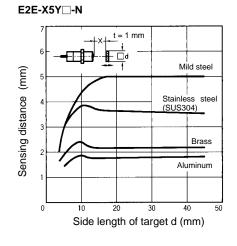


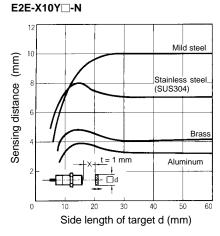


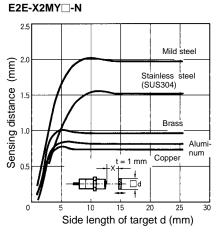

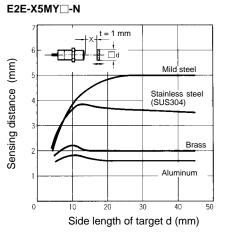



## ■ SENSING DISTANCE VS. SENSING OBJECT (TYPICAL) – CONTINUED

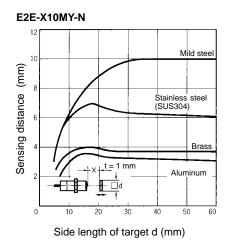


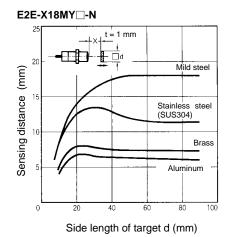

### Models with Short Circuit Protection (E2E-X□Y□-53-US)

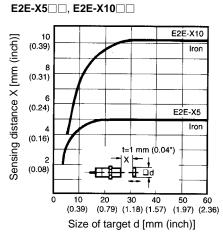

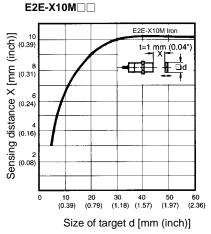

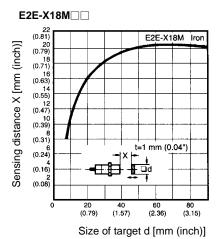

1)	Im	er	101	nc
			1.7	 11.


## **■ DRAWING LOCATOR**

Туре			Part number	Figure number
Prewired without	Shielded	M8	E2E-X1R5Y□-N	1
short-circuit		M12	E2E-X2Y□-N	3
protection		M18	E2E-X5Y□-N	5
		M30	E2E-X10Y□-N	7
	Unshielded	M8	E2E-X2MY□-N	2
		M12	E2E-X5MY□-N	4
		M18	E2E-X10MY□-N	6
		M30	E2E-X18MY□-N	8
Prewired with	Shielded	M18	E2E-X5Y□-53-US	9
short-circuit		M30	E2E-X10Y□-53-US	11
protection	Unshielded	M18	E2E-X10MY□-53-US	10
		M30	E2E-X18MY□-53-US	12
4-pin connector	Shielded	M12	E2E-X2Y-□-M1-N	13
(M12)		M18	E2E-X5Y1-M1-N	15
		M30	E2E-X10Y-□-M1-N	17
	Unshielded	M12	E2E-X5MY-□-M1-N	14
		M18	E2E-X10MY-□-M1-N	16
		M30	E2E-X18MY-□-M1-N	18
3-pin MicroChange	Shielded	M12	E2E-X2Y-□-M4	13
connector (M12)		M18	E2E-X5Y-□-M4	15
		M30	E2E-X10Y-□-M4	17
	Unshielded	M12	E2E-X5MY-□-M4	14
		M18	E2E-X10MY-□-M4	16
		M30	E2E-X18MY-□-M4	18

Unit: mm (inch)

# Prewired Models (Shielded)

(Snieided)

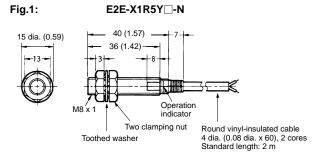

Prewired Models (Unshielded)

Fig. 2: E2E-X2MY -N

15 dia. (0.59)

40 (1.57)

36 (1.42)

Operation indicator

Two clamping Round vinyl-insulated cable 4 dia. (0.08 dia. x 60), 2 cores

Standard length: 2 m

Fig. 3: E2E-X2Y□-N

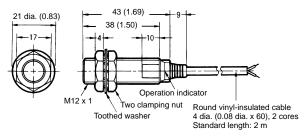


Fig. 4: E2E-X5MY□-N

Toothed washer

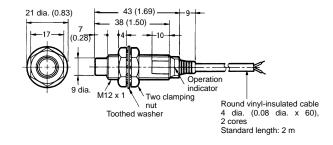


Fig. 5: E2E-X5Y□-N

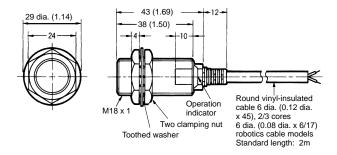


Fig. 6: E2E-X10MY□-N

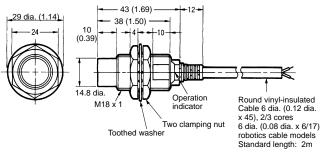


Fig. 7: E2E-X10Y□-N


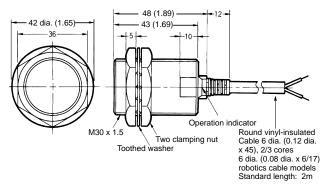


Fig. 8: E2E-X18MY□-N

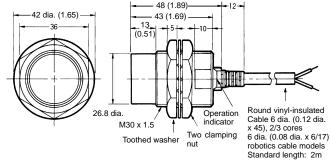


### ■ PRE-WIRED MODELS WITH SHORT-CIRCUIT PROTECTION

#### **Shielded** Fig. 9: E2E-X5Y -53-US M18 4 (0.16) P=1.0 + + 24 (0.945) Indicator across flats 18.5 dia Cable: (0.728)29 (1.14) 6 (0.24) dia. 2 m (6.56 ft) 40 (1.57)

47 (1.85)

**Unshielded** Fig.10: E2E-X10MY -53-US 24 (0.945) Indicator across flats Cable: 6 (0.24) dia. (0.728)10 (0.39) 2 m (6.56 ft) 29 (1.14) 40 (1.57) - 47 (1.85)


Fig. 11: E2E-X10Y -53-US M30 P=1.5 36 (1.417) (0.06)across flats Indicator Cable: 6 (0.24) dia. 30.5 dia (1.201) 38 (1.50) 2 m (6.56 ft) 50 (1.97) 57 (2.24)

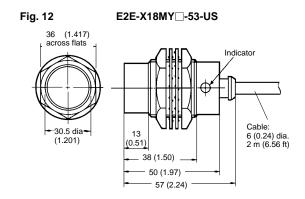

E2E-X5MY□-M1-N

### **Connector Models** (Shielded)


Fig. 13: E2E-X2Y1-M1-N

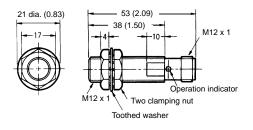

**Connector Models** (Unshielded)

Fig. 14:

21 dia. (0.83) 53 (2.09) 38 (1.50) -M12 x 1 (0.28)



53 (2.09) 29 dia. (1.14) 38 (1.50) -1-10 M12 x 1 Operation indicator M18 x 1

E2E-X5Y1-M1-N

Two clamping nut

Toothed washer


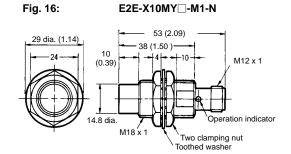


Fig. 15:


# Connector Models (Shielded), continued

Fig.17: E2E-X10Y1-M1-N

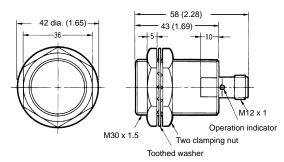

# Connector Models (Unshielded), continued

Fig. 18: E2E-X18MY□-M1-N

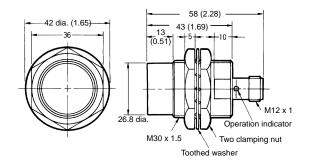

## **■ MOUNTING HOLES**



Dimensions	M8	M12	M18	M30
F (mm)	$8.5^{+0.5}/_0$ dia.	12.5 <sup>+0.5</sup> / <sub>0</sub> dia.	18.5 <sup>+0.5</sup> / <sub>0</sub> dia.	$30.5^{+0.5}/_0$ dia.

# Installation

### **■ PIN ARRANGEMENT**

## E2E-X□Y□-M1 AC 2-wire Models


Output configuration	Applicable models	Pin arrangement
NO	E2E-X□Y1-M1-N	Note: Terminals 1 and 2 are not used.
NC	E2E-X□Y2-M1-N	Note: Terminals 3 and 4 are not used.
NO, NC	E2E-X□Y□-M4	Load O AC


## **Precautions**

### **■** MOUNTING

Do not tighten the nut with excessive force. A washer must be used with the nut.



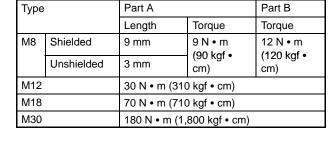




Note: The table above right shows the tightening torques for part A and part B nuts. In the previous examples, the nut is on the sensor head side (part B) and hence the tightening torque for part B applies. If this nut is in part A, the tightening torque for part A applies instead.

### **■ EFFECTS OF SURROUNDING METAL**


When mounting the E2E within a metal panel, ensure that the clearances given in the following table are maintained. Failure to maintain these distances may cause deterioration in the performance of the sensor.



Туре		Dimension	M8	M12	M18	M30
E2E-X□Y□-N	Shielded	$\ell$	0 mm	0 mm	0 mm	0 mm
AC 2-wire		d	8 mm	12 mm	18 mm	30 mm
		D	0 mm	0 mm	0 mm	0 mm
		m	4.5 mm	8 mm	20 mm	40 mm
		n	12 mm	18 mm	27 mm	45 mm
	Unshielded	$\ell$	6 mm	15 mm	22 mm	30 mm
		d	24 mm	40 mm	55 mm	90 mm
		D	6 mm	15 mm	22 mm	30 mm
		m	8 mm	20 mm	40 mm	70 mm
		n	24 mm	36 mm	54 mm	90 mm

### **■ MUTUAL INTERFERENCE**

When installing two or more Sensors face-to-face or side-by-side, ensure that the minimum distances given in the following table are maintained.



Туре		Dimension	M8	M12	M18	M30
E2E-X□Y□-N	Shielded	Α	20 mm	30 (20) mm	50 (30) mm	100 (50) mm
AC 2-wire		В	15 mm	20 (12) mm	35 (18) mm	70 (35) mm
	Unshielded	Α	80 mm	120 (60) mm	200 (100) mm	300 (100) mm
		В	60 mm	100 (50) mm	110 (60) mm	200 (100) mm

Note: The figures in parentheses refer to Sensors operating at different frequencies.

### **■ INSTALLATION**

### **Power Reset Time**

The Proximity Sensor is ready to operate within 100 ms after power is supplied. If power supplies are connected to the Proximity Sensor and load respectively, be sure to supply power to the Proximity Sensor before supplying power to the load.

### **Power OFF**

The Proximity Sensor may output a pulse signal when it is turned off. Therefore, it is recommended to turn off the load before turning off the Proximity Sensor.

### **Power Supply Transformer**

When using a DC power supply, make sure that the DC power supply has an insulated transformer. Do not use a DC power supply with an auto-transformer.

### **Sensing Target**

Metal Coating:

The sensing distances of the Proximity Sensor vary with the metal coating on sensing targets.

### **■** WIRING

### **High-tension Lines**

#### Wiring through Metal Conduit

If there is a power or high-tension line near the cord of the Proximity Sensor, wire the cord through an independent metal conduit to prevent against Proximity Sensor damage or malfunctioning.

#### **Cable Tractive Force**

Do not pull cable with the tractive forces exceeding the following.

Diameter	Tractive force
4 mm dia. max.	30 N max.
4 mm dia. min.	50 N max.

### **■** MOUNTING

The Proximity Sensor must not be subjected to excessive shock with a hammer when it is installed, or the Proximity Sensor may be damaged or lose its water-resistance.

### **■** ENVIRONMENT

### Water Resistance

Do not use the Proximity Sensor underwater, outdoors, or in the rain.

### **Operating Environment**

Be sure to use the Proximity Sensor within its operating ambient temperature range and do not use the Proximity Sensor outdoors to maintain its reliability and life expectancy. Although the Proximity Sensor is water resistant, a cover to protect the Proximity Sensor from water or water soluble machining oil is recommended so that its reliability and life expectancy can be maintained.

Do not use the Proximity Sensor in an environment with chemical gas (e.g., strong alkaline or acid gasses including nitric, chromic, and concentrated sulfuric acid gases).

# ■ CONNECTING LOAD TO AC 2-WIRE SENSOR

Refer to the following before using AC or DC 2-wire Proximity Sensors.

#### **Surge Protection**

Although the Proximity Sensor has a surge absorption circuit, if there is any machine that has a large surge current (e.g., a motor or welding machine) near the Proximity Sensor, connect a surge absorber to the machine.

### **Leakage Current**

When it is OFF, the Proximity Sensor has leakage current. Refer to Leakage Current Characteristics. In this case, the load is imposed with a small voltage and the load may not be reset. Before using the Proximity Sensor, make sure that this voltage is less than the load reset voltage. The AC 2-wire Proximity Sensor cannot be connected to any card-lift-off relay (e.g., the G2A) because contact vibration of the relay will be caused by the leakage current and the life of the relay will be shortened.

#### **Countermeasures Against Leakage Current**

#### **AC 2-wire Models**

Connect a bleeder resistor as the bypass for the leakage current so that the current flowing into the load will be less than the load reset current.

As shown in the following diagram, connect the bleeder resistor so that the current flowing into the Proximity Sensor will be 10 mA minimum and the residual voltage imposed on the load will be less than the load reset voltage.



Refer to the following to calculate the bleeder resistance and the allowable power of the bleeder resistor.

 $R \leq V_S/(10 - I) (k\Omega)$ 

 $P > V_S^2/R \text{ (mW)}$ 

- P: The allowable power of the bleeder resistor. (The actual power capacity of the bleeder resistor must be at least a few times as large as the allowable power of the bleeder resistor.)
- I: Load current (mA)

The following resistors are recommended.

100 VAC (supply voltage): A resistor with a resistance of 10  $k\Omega$  maximum and an allowable power of 3 W minimum

200 VAC (supply voltage): A resistor with a resistance of 20  $k\Omega$  maximum and an allowable power of 10 W minimum

If these resistors generate excessive heat, use a resistor with a resistance of 10  $k\Omega$  maximum and an allowable power of 5 W minimum at 100 VAC and a resistor with a resistance of 20  $k\Omega$  maximum and an allowable power of 10 W minimum at 200 VAC instead.

### ■ PRECAUTIONS FOR AC 2-WIRE PROXIMITY SENSORS IN OPERATION

### Connector

Model	Connection type	Method	Description
AC 2-wire	AND (serial connection)	Correct    Correct   Vs   Load   Vs   Vs   Vs   Vs   Vs   Vs   100 V	If 100 or 200 VAC is imposed on the Proximity Sensors, $V_L$ (i.e., the voltage imposed on the load) will be obtained from the following. $V_L = V_S - \text{(residual voltage x no. of Proximity Sensors) (V)}$ Therefore, if $V_L$ is lower than the load operating voltage, the load will not operate. A maximum of three Proximity Sensors can be connected in series provided that the supply voltage is 100 V minimum.

## ■ PRECAUTIONS FOR AC 2-WIRE PROXIMITY SENSORS IN OPERATION, CONTINUED

Model	Connection type	Method	Description
AC 2-wire	OR (parallel connection)	Incorrect	In principle, more than two Proximity Sensors cannot be connected in parallel.
		Correct	Provided that Proximity Sensor A does not operate with Proximity Sensor B simultaneously and there is no need to keep the load operating continuously, the Proximity Sensors can be connected in parallel. In this case, however, due to the total leakage current of the Proximity Sensors, the load may not reset properly.
		VAC power supply Vs	It is not possible to keep the load operating continuously with Proximity Sensors A and B in simultaneous operation to sense sensing objects due to the following reason.
			When Proximity Sensor A is ON, the voltage imposed on Proximity Sensor A will drop to approximately 10 V and the load current flows into Proximity Sensor A, and when one of the sensing objects is close to Proximity Sensor B, Proximity Sensor B will not operate because the voltage imposed on Proximity Sensor B is 10 V, which is too low. When Proximity Sensor A is OFF, the voltage imposed on Proximity Sensor B will reach the supply voltage and Proximity Sensor B will reach the supply voltage and Proximity Sensor A as well as Proximity Sensor B will be OFF for approximately 10 ms, which resets the load for an instant. To prevent the instantaneous resetting of the load, use a relay as shown on the left.

NOTE: DIMENSIONS SHOWN ARE IN MILLIMETERS. To convert millimeters to inches divide by 25.4.

OMRON ELECTRONICS, INC.
One East Commerce Drive
Schaumburg, IL 60173
1-800-55-OMRON

OMRON CANADA, INC. 885 Milner Avenue Scarborough, Ontario M1B 5V8 416-286-6465